



OM-316

087 083Q

August 2004

## Processes



Stick (SMAW) Welding

## Description

AC/DC, 300/200 AC/DC Models:




225 And 300 Models:



Arc Welding Power Source

# Thunderbolt<sup>®</sup> XL

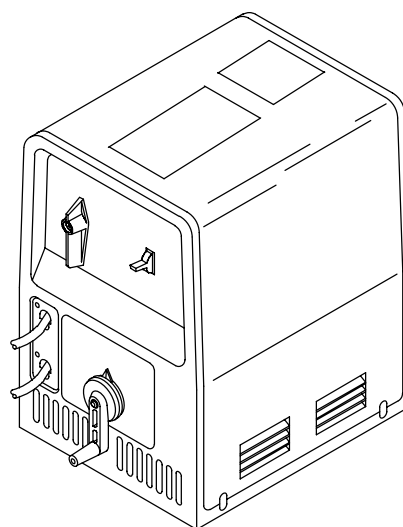

AC/DC, 300/200 AC/DC, 225, And 300



Visit our website at  
[www.MillerWelds.com](http://www.MillerWelds.com)

## OWNER'S MANUAL

# From Miller to You

---

*Thank you and congratulations* on choosing Miller. Now you can get the job done and get it done right. We know you don't have time to do it any other way.

That's why when Niels Miller first started building arc welders in 1929, he made sure his products offered long-lasting value and superior quality. Like you, his customers couldn't afford anything less. Miller products had to be more than the best they could be. They had to be the best you could buy.

Today, the people that build and sell Miller products continue the tradition. They're just as committed to providing equipment and service that meets the high standards of quality and value established in 1929.

This Owner's Manual is designed to help you get the most out of your Miller products. Please take time to read the Safety precautions. They will help you protect yourself against potential hazards on the worksite.



Miller is the first welding equipment manufacturer in the U.S.A. to be registered to the ISO 9001:2000 Quality System Standard.

We've made installation and operation quick and easy. With Miller you can count on years of reliable service with proper maintenance. And if for some reason the unit needs repair, there's a Troubleshooting section that will help you figure out what the problem is. The parts list will then help you to decide the exact part you may need to fix the problem. Warranty and service information for your particular model are also provided.



Miller Electric manufactures a full line of welders and welding related equipment. For information on other quality Miller products, contact your local Miller distributor to receive the latest full line catalog or individual catalog sheets. **To locate your nearest distributor or service agency call 1-800-4-A-Miller, or visit us at [www.MillerWelds.com](http://www.MillerWelds.com) on the web.**



Working as hard as you do – every power source from Miller is backed by the most hassle-free warranty in the business.



# TABLE OF CONTENTS

<b>SECTION 1 – SAFETY PRECAUTIONS - READ BEFORE USING</b>	<b>1</b>
1-1. Symbol Usage	1
1-2. Arc Welding Hazards	1
1-3. Additional Symbols For Installation, Operation, And Maintenance	3
1-4. California Proposition 65 Warnings	3
1-5. Principal Safety Standards	4
1-6. EMF Information	4
<b>SECTION 2 – CONSIGNES DE SÉCURITÉ – À LIRE AVANT UTILISATION</b>	<b>5</b>
2-1. Signification des symboles	5
2-2. Dangers relatifs au soudage à l'arc	5
2-3. Autres symboles relatifs à l'installation, au fonctionnement et à l'entretien de l'appareil.	7
2-4. Principales normes de sécurité	8
2-5. Information sur les champs électromagnétiques	8
<b>SECTION 3 – DEFINITIONS</b>	<b>9</b>
3-1. Symbols And Definitions	9
3-2. Manufacturer's Rating Labels	9
<b>SECTION 4 – INSTALLATION</b>	<b>10</b>
4-1. Specifications	10
4-2. Duty Cycle Charts	11
4-3. Volt-Ampere Curves	12
4-4. Selecting A Location	14
4-5. Installing Electrode Holder And Work Clamp	15
4-6. Weld Output Cables	15
4-7. Electrical Service Guide	16
4-8. Internal Connections For Operating 115/230 Volts, 225 Amperes AC And AC/DC Models From 115 Volts	17
4-9. Internal Connections For Operating 230/400 Volts, 300/200 Amperes AC/DC Or 300 Amperes AC Models From 230 Volts	18
4-10. Connecting Input Power	19
<b>SECTION 5 – OPERATION</b>	<b>20</b>
5-1. Controls	20
<b>SECTION 6 – MAINTENANCE &amp; TROUBLESHOOTING</b>	<b>22</b>
6-1. Routine Maintenance	22
6-2. Lubricating Shunt Block And Anti-Noise Adjustment	22
6-3. Reinstalling Amperage Adjustment Indicator	23
6-4. Troubleshooting	24
<b>SECTION 7 – ELECTRICAL DIAGRAMS</b>	<b>25</b>
<b>SECTION 8 – WELDING METHODS &amp; TROUBLESHOOTING</b>	<b>30</b>
8-1. Shielded Metal Arc Welding (SMAW) Procedure	30
8-2. Electrode And Amperage Selection Chart	31
8-3. Striking An Arc	32
8-4. Positioning The Electrode Holder	32
8-5. Weld Bead Characteristics	33
8-6. Conditions That Affect Weld Bead Shape	33
8-7. Electrode Movement During Welding	34
8-8. Butt Joints	34
8-9. Lap Joints	35
8-10. Tee Joints	35
<b>SECTION 9 – PARTS LIST</b>	<b>38</b>
<b>OPTIONS AND ACCESSORIES</b>	
<b>WARRANTY</b>	



# SECTION 1 – SAFETY PRECAUTIONS - READ BEFORE USING

som \_8/03

## 1-1. Symbol Usage



Means Warning! Watch Out! There are possible hazards with this procedure! The possible hazards are shown in the adjoining symbols.

▲ Marks a special safety message.

☞ Means "Note"; not safety related.



This group of symbols means Warning! Watch Out! possible ELECTRIC SHOCK, MOVING PARTS, and HOT PARTS hazards. Consult symbols and related instructions below for necessary actions to avoid the hazards.

## 1-2. Arc Welding Hazards

▲ The symbols shown below are used throughout this manual to call attention to and identify possible hazards. When you see the symbol, watch out, and follow the related instructions to avoid the hazard. The safety information given below is only a summary of the more complete safety information found in the Safety Standards listed in Section 1-5. Read and follow all Safety Standards.

▲ Only qualified persons should install, operate, maintain, and repair this unit.

▲ During operation, keep everybody, especially children, away.



### ELECTRIC SHOCK can kill.

Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also


live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.

- Do not touch live electrical parts.
- Wear dry, hole-free insulating gloves and body protection.
- Insulate yourself from work and ground using dry insulating mats or covers big enough to prevent any physical contact with the work or ground.
- Do not use AC output in damp areas, if movement is confined, or if there is a danger of falling.
- Use AC output ONLY if required for the welding process.
- If AC output is required, use remote output control if present on unit.
- Disconnect input power or stop engine before installing or servicing this equipment. Lockout/tagout input power according to OSHA 29 CFR 1910.147 (see Safety Standards).
- Properly install and ground this equipment according to its Owner's Manual and national, state, and local codes.
- Always verify the supply ground – check and be sure that input power cord ground wire is properly connected to ground terminal in disconnect box or that cord plug is connected to a properly grounded receptacle outlet.
- When making input connections, attach proper grounding conductor first – double-check connections.
- Frequently inspect input power cord for damage or bare wiring – replace cord immediately if damaged – bare wiring can kill.
- Turn off all equipment when not in use.
- Do not use worn, damaged, undersized, or poorly spliced cables.
- Do not drape cables over your body.

- If earth grounding of the workpiece is required, ground it directly with a separate cable.
- Do not touch electrode if you are in contact with the work, ground, or another electrode from a different machine.
- Use only well-maintained equipment. Repair or replace damaged parts at once. Maintain unit according to manual.
- Wear a safety harness if working above floor level.
- Keep all panels and covers securely in place.
- Clamp work cable with good metal-to-metal contact to workpiece or worktable as near the weld as practical.
- Insulate work clamp when not connected to workpiece to prevent contact with any metal object.
- Do not connect more than one electrode or work cable to any single weld output terminal.

### SIGNIFICANT DC VOLTAGE exists after removal of input power on inverters.

- Turn Off inverter, disconnect input power, and discharge input capacitors according to instructions in Maintenance Section before touching any parts.

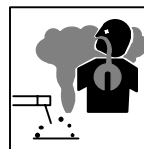

### FUMES AND GASES can be hazardous.

Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

- Keep your head out of the fumes. Do not breathe the fumes.
- If inside, ventilate the area and/or use exhaust at the arc to remove welding fumes and gases.
- If ventilation is poor, use an approved air-supplied respirator.
- Read the Material Safety Data Sheets (MSDSs) and the manufacturer's instructions for metals, consumables, coatings, cleaners, and degreasers.
- Work in a confined space only if it is well ventilated, or while wearing an air-supplied respirator. Always have a trained watch-person nearby. Welding fumes and gases can displace air and lower the oxygen level causing injury or death. Be sure the breathing air is safe.
- Do not weld in locations near degreasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapors to form highly toxic and irritating gases.
- Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and if necessary, while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.



### **ARC RAYS can burn eyes and skin.**

Arc rays from the welding process produce intense visible and invisible (ultraviolet and infrared) rays that can burn eyes and skin. Sparks fly off from the weld.


- Wear a welding helmet fitted with a proper shade of filter to protect your face and eyes when welding or watching (see ANSI Z49.1 and Z87.1 listed in Safety Standards).
- Wear approved safety glasses with side shields under your helmet.
- Use protective screens or barriers to protect others from flash and glare; warn others not to watch the arc.
- Wear protective clothing made from durable, flame-resistant material (leather and wool) and foot protection.



### **WELDING can cause fire or explosion.**

Welding on closed containers, such as tanks, drums, or pipes, can cause them to blow up. Sparks can fly off from the welding arc. The flying sparks, hot workpiece, and hot equipment can cause fires and burns. Accidental contact of electrode to metal objects can cause sparks, explosion, overheating, or fire. Check and be sure the area is safe before doing any welding.

- Protect yourself and others from flying sparks and hot metal.
- Do not weld where flying sparks can strike flammable material.
- Remove all flammables within 35 ft (10.7 m) of the welding arc. If this is not possible, tightly cover them with approved covers.
- Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas.
- Watch for fire, and keep a fire extinguisher nearby.
- Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.
- Do not weld on closed containers such as tanks, drums, or pipes, unless they are properly prepared according to AWS F4.1 (see Safety Standards).
- Connect work cable to the work as close to the welding area as practical to prevent welding current from traveling long, possibly unknown paths and causing electric shock and fire hazards.
- Do not use welder to thaw frozen pipes.
- Remove stick electrode from holder or cut off welding wire at contact tip when not in use.
- Wear oil-free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap.
- Remove any combustibles, such as a butane lighter or matches, from your person before doing any welding.

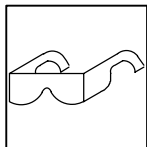

### **FLYING METAL can injure eyes.**

- Welding, chipping, wire brushing, and grinding cause sparks and flying metal. As welds cool, they can throw off slag.
- Wear approved safety glasses with side shields even under your welding helmet.




### **BUILDUP OF GAS can injure or kill.**

- Shut off shielding gas supply when not in use.
- Always ventilate confined spaces or use approved air-supplied respirator.




### **HOT PARTS can cause severe burns.**

- Do not touch hot parts bare handed.
- Allow cooling period before working on gun or torch.

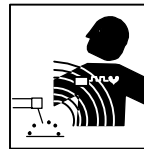

### **MAGNETIC FIELDS can affect pacemakers.**


- Pacemaker wearers keep away.
- Wearers should consult their doctor before going near arc welding, gouging, or spot welding operations.

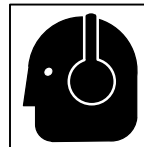

### **NOISE can damage hearing.**

Noise from some processes or equipment can damage hearing.

- Wear approved ear protection if noise level is high.

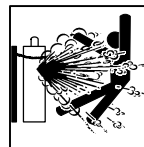

### **CYLINDERS can explode if damaged.**

Shielding gas cylinders contain gas under high pressure. If damaged, a cylinder can explode. Since gas cylinders are normally part of the welding process, be sure to treat them carefully.

- Protect compressed gas cylinders from excessive heat, mechanical shocks, slag, open flames, sparks, and arcs.
- Install cylinders in an upright position by securing to a stationary support or cylinder rack to prevent falling or tipping.
- Keep cylinders away from any welding or other electrical circuits.
- Never drape a welding torch over a gas cylinder.
- Never allow a welding electrode to touch any cylinder.
- Never weld on a pressurized cylinder – explosion will result.
- Use only correct shielding gas cylinders, regulators, hoses, and fittings designed for the specific application; maintain them and associated parts in good condition.
- Turn face away from valve outlet when opening cylinder valve.
- Keep protective cap in place over valve except when cylinder is in use or connected for use.
- Read and follow instructions on compressed gas cylinders, associated equipment, and CGA publication P-1 listed in Safety Standards.

### 1-3. Additional Symbols For Installation, Operation, And Maintenance




#### **FIRE OR EXPLOSION hazard.**

- Do not install or place unit on, over, or near combustible surfaces.
- Do not install unit near flammables.
- Do not overload building wiring – be sure power supply system is properly sized, rated, and protected to handle this unit.




#### **FALLING UNIT can cause injury.**

- Use lifting eye to lift unit only, NOT running gear, gas cylinders, or any other accessories.
- Use equipment of adequate capacity to lift and support unit.
- If using lift forks to move unit, be sure forks are long enough to extend beyond opposite side of unit.

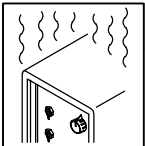

#### **OVERUSE can cause OVERHEATING**

- Allow cooling period; follow rated duty cycle.
- Reduce current or reduce duty cycle before starting to weld again.
- Do not block or filter airflow to unit.

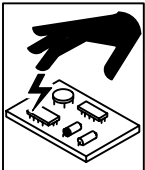

#### **STATIC (ESD) can damage PC boards.**

- Put on grounded wrist strap BEFORE handling boards or parts.
- Use proper static-proof bags and boxes to store, move, or ship PC boards.



#### **MOVING PARTS can cause injury.**

- Keep away from moving parts.
- Keep away from pinch points such as drive rolls.




#### **WELDING WIRE can cause injury.**

- Do not press gun trigger until instructed to do so.
- Do not point gun toward any part of the body, other people, or any metal when threading welding wire.




#### **MOVING PARTS can cause injury.**

- Keep away from moving parts such as fans.
- Keep all doors, panels, covers, and guards closed and securely in place.

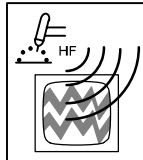

#### **H.F. RADIATION can cause interference.**

- High-frequency (H.F.) can interfere with radio navigation, safety services, computers, and communications equipment.
- Have only qualified persons familiar with electronic equipment perform this installation.
- The user is responsible for having a qualified electrician promptly correct any interference problem resulting from the installation.
- If notified by the FCC about interference, stop using the equipment at once.
- Have the installation regularly checked and maintained.
- Keep high-frequency source doors and panels tightly shut, keep spark gaps at correct setting, and use grounding and shielding to minimize the possibility of interference.

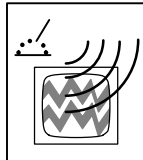

#### **ARC WELDING can cause interference.**

- Electromagnetic energy can interfere with sensitive electronic equipment such as computers and computer-driven equipment such as robots.
- Be sure all equipment in the welding area is electromagnetically compatible.
- To reduce possible interference, keep weld cables as short as possible, close together, and down low, such as on the floor.
- Locate welding operation 100 meters from any sensitive electronic equipment.
- Be sure this welding machine is installed and grounded according to this manual.
- If interference still occurs, the user must take extra measures such as moving the welding machine, using shielded cables, using line filters, or shielding the work area.

### 1-4. California Proposition 65 Warnings

- ▲ Welding or cutting equipment produces fumes or gases which contain chemicals known to the State of California to cause birth defects and, in some cases, cancer. (California Health & Safety Code Section 25249.5 et seq.)
- ▲ Battery posts, terminals and related accessories contain lead and lead compounds, chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. Wash hands after handling.

#### **For Gasoline Engines:**

- ▲ Engine exhaust contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.

#### **For Diesel Engines:**

- ▲ Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm.

## 1-5. Principal Safety Standards

*Safety in Welding, Cutting, and Allied Processes*, ANSI Standard Z49.1, from American Welding Society, 550 N.W. LeJeune Rd, Miami FL 33126 (phone: 305-443-9353, website: [www.aws.org](http://www.aws.org)).

*Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping*, American Welding Society Standard AWS F4.1, from American Welding Society, 550 N.W. LeJeune Rd, Miami, FL 33126 (phone: 305-443-9353, website: [www.aws.org](http://www.aws.org)).

*National Electrical Code*, NFPA Standard 70, from National Fire Protection Association, P.O. Box 9101, 1 Battery March Park, Quincy, MA 02269-9101 (phone: 617-770-3000, website: [www.nfpa.org](http://www.nfpa.org) and [www.sparky.org](http://www.sparky.org)).

*Safe Handling of Compressed Gases in Cylinders*, CGA Pamphlet P-1, from Compressed Gas Association, 1735 Jefferson Davis Highway, Suite 1004, Arlington, VA 22202-4102 (phone: 703-412-0900, website: [www.cganet.com](http://www.cganet.com)).

*Code for Safety in Welding and Cutting*, CSA Standard W117.2, from Canadian Standards Association, Standards Sales, 178 Rexdale

Boulevard, Rexdale, Ontario, Canada M9W 1R3 (phone: 800-463-6727 or in Toronto 416-747-4044, website: [www.csa-international.org](http://www.csa-international.org)).

*Practice For Occupational And Educational Eye And Face Protection*, ANSI Standard Z87.1, from American National Standards Institute, 11 West 42nd Street, New York, NY 10036-8002 (phone: 212-642-4900, website: [www.ansi.org](http://www.ansi.org)).

*Standard for Fire Prevention During Welding, Cutting, and Other Hot Work*, NFPA Standard 51B, from National Fire Protection Association, P.O. Box 9101, 1 Battery March Park, Quincy, MA 02269-9101 (phone: 617-770-3000, website: [www.nfpa.org](http://www.nfpa.org) and [www.sparky.org](http://www.sparky.org)).

OSHA, Occupational Safety and Health Standards for General Industry, Title 29, Code of Federal Regulations (CFR), Part 1910, Subpart Q, and Part 1926, Subpart J, from U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250 (there are 10 Regional Offices—phone for Region 5, Chicago, is 312-353-2220, website: [www.osha.gov](http://www.osha.gov)).

## 1-6. EMF Information

Considerations About Welding And The Effects Of Low Frequency Electric And Magnetic Fields

Welding current, as it flows through welding cables, will cause electromagnetic fields. There has been and still is some concern about such fields. However, after examining more than 500 studies spanning 17 years of research, a special blue ribbon committee of the National Research Council concluded that: "The body of evidence, in the committee's judgment, has not demonstrated that exposure to power-frequency electric and magnetic fields is a human-health hazard." However, studies are still going forth and evidence continues to be examined. Until the final conclusions of the research are reached, you may wish to minimize your exposure to electromagnetic fields when welding or cutting.

To reduce magnetic fields in the workplace, use the following procedures:

1. Keep cables close together by twisting or taping them.
2. Arrange cables to one side and away from the operator.
3. Do not coil or drape cables around your body.
4. Keep welding power source and cables as far away from operator as practical.
5. Connect work clamp to workpiece as close to the weld as possible.

### About Pacemakers:

Pacemaker wearers consult your doctor first. If cleared by your doctor, then following the above procedures is recommended.



# SECTION 2 – CONSIGNES DE SÉCURITÉ – À LIRE AVANT UTILISATION

som\_fre 8/03

## 2-1. Signification des symboles



Signifie « Mise en garde. Faire preuve de vigilance. » Cette procédure présente des risques identifiés par les symboles adjacents aux directives.

### ▲ Identifie un message de sécurité particulier.

☞ Signifie « NOTA » ; n'est pas relatif à la sécurité.



Ce groupe de symboles signifie « Mise en garde. Faire preuve de vigilance. » Il y a des dangers liés aux CHOCs ÉLECTRIQUES, aux PIÈCES EN MOUVEMENT et aux PIÈCES CHAUDES. Se reporter aux symboles et aux directives ci-dessous afin de connaître les mesures à prendre pour éviter tout danger.

## 2-2. Dangers relatifs au soudage à l'arc

▲ Les symboles ci-après sont utilisés tout au long du présent manuel pour attirer l'attention sur les dangers potentiels et les identifier. Lorsqu'on voit un symbole, faire preuve de vigilance et suivre les directives mentionnées afin d'éviter tout danger. Les consignes de sécurité énoncées ci-après ne font que résumer le contenu des normes de sécurité mentionnées à la section 2-4. Lire et respecter toutes ces normes.

▲ L'installation, l'utilisation, l'entretien et les réparations ne doivent être confiés qu'à des personnes qualifiées.

▲ Pendant l'utilisation de l'appareil, tenir à l'écart toute personne, en particulier les enfants.



### LES DÉCHARGES ÉLECTRIQUES peuvent être mortelles.


Un simple contact avec des pièces sous tension peut causer une électrocution ou des blessures graves. L'électrode et le circuit de soudage sont sous tension dès que l'appareil est en fonctionnement. Le circuit d'entrée et les circuits internes de l'appareil sont également sous tension. En soudage semi-automatique ou automatique, le fil, le dévidoir, le logement des galets d'entraînement et les pièces métalliques en contact avec le fil de soudage sont sous tension. Tout matériel mal installé ou mal mis à la terre présente un danger.

- Ne jamais toucher aux pièces électriques sous tension.
- Porter des gants et des vêtements de protection secs et exempts de trous.
- S'isoler de la pièce et de la terre au moyen de tapis ou autres dispositifs isolants suffisamment grands pour empêcher tout contact physique avec la pièce ou la terre.
- Ne pas se servir d'une source de courant alternatif dans les zones humides, les endroits confinés ou là où on risque de tomber.
- Ne se servir d'une source de courant alternatif QUE si le procédé de soudage l'exige.
- Si l'utilisation d'une source de courant alternatif s'avère nécessaire, se servir de la fonction de télécommande si l'appareil en est équipé.
- Couper l'alimentation ou arrêter le moteur avant de procéder à l'installation, à la réparation ou à l'entretien de l'appareil. Couper/étiqueter l'alimentation selon la norme OSHA 29 CFR 1910.147 (voir les normes de sécurité).
- Installer et mettre à la terre correctement l'appareil conformément à son manuel d'utilisation et aux codes nationaux, provinciaux et municipaux.
- Toujours vérifier la terre du cordon d'alimentation – Vérifier et s'assurer que le fil de terre du cordon d'alimentation est bien raccordé à la borne de terre du sectionneur ou que la fiche du cordon est raccordée à une prise correctement mise à la terre.
- Pour exécuter les branchements d'entrée, fixer d'abord le conducteur de mise à la terre adéquat et contre-vérifier les connexions.
- Vérifier fréquemment le cordon d'alimentation et s'assurer qu'il n'est ni endommagé ni dénudé ; le remplacer immédiatement s'il est endommagé – tout câble dénudé peut causer une électrocution.
- Mettre l'appareil hors tension quand on ne l'utilise pas.
- Ne pas utiliser de câbles usés, endommagés, de calibre insuffisant ou mal épissés.
- Ne pas s'enrouler les câbles autour du corps.
- Si la pièce soudée doit être mise à la terre, le faire directement avec un câble distinct.
- Ne pas toucher l'électrode quand on est en contact avec la pièce, la terre ou une électrode d'une autre machine.

- N'utiliser que du matériel en bon état. Réparer ou remplacer sur-le-champ les pièces endommagées. Entretenir l'appareil conformément au présent manuel.
- Porter un harnais de sécurité quand on travaille en hauteur.
- Maintenir solidement en place tous les panneaux et capots.
- Fixer le câble de retour de façon à obtenir un bon contact métal sur métal avec la pièce à souder ou la table de travail, le plus près possible de la soudure.
- Ne pas connecter plus d'une électrode ou plus d'un câble de masse à un même terminal de sortie.

### Il subsiste un COURANT CONTINU IMPORTANT dans les convertisseurs après la suppression de l'alimentation électrique.

- Arrêter les convertisseurs, débrancher le courant électrique et décharger les condensateurs d'alimentation selon les instructions énoncées à la section Entretien avant de toucher les pièces.

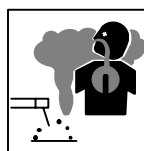

### LES FUMÉES ET LES GAZ peuvent être dangereux.

Le soudage génère des fumées et des gaz dont l'inhalation peut être dangereuse pour la santé.

- Se tenir à distance des fumées et ne pas les inhaler.
- À l'intérieur, ventiler la zone et/ou utiliser un dispositif d'aspiration au niveau de l'arc pour l'évacuation des fumées et des gaz de soudage.
- Si la ventilation est insuffisante, utiliser un respirateur à adduction d'air agréé.
- Lire les fiches techniques de santé-sécurité (FTSS) et les instructions du fabricant concernant les métaux, les consommables, les revêtements, les nettoyeurs et les dégraissants.
- Ne travailler dans un espace clos que s'il est bien ventilé ou porter un respirateur à adduction d'air. Demander toujours à un surveillant dûment formé de se tenir à proximité. Des fumées et des gaz de soudage peuvent se substituer à l'air, abaisser la teneur en oxygène et causer des lésions ou des accidents mortels. S'assurer que l'air est respirable.
- Ne pas souder à proximité d'opérations de dégraissage, de nettoyage ou de pulvérisation. La chaleur et les rayons de l'arc peuvent réagir en présence de vapeurs et former des gaz hautement toxiques et irritants.
- Ne pas souder de métaux munis d'un revêtement, tels que la tôle d'acier galvanisée, plombée ou cadmiée, à moins que le revêtement n'ait été enlevé dans la zone de soudage, que l'endroit soit bien ventilé, et si nécessaire, porter un respirateur à adduction d'air. Les revêtements et tous les métaux renfermant ces éléments peuvent dégager des fumées toxiques lorsqu'on les soude.



### LES RAYONS DE L'ARC peuvent causer des brûlures oculaires et cutanées.

Le rayonnement de l'arc génère des rayons visibles et invisibles intenses (ultraviolets et infrarouges) susceptibles de causer des brûlures oculaires et cutanées. Des étincelles sont projetées pendant le soudage.


- Porter un masque de soudage muni d'un filtre de la nuance adéquate pour se protéger le visage et les yeux pendant le soudage ou pour regarder (voir les normes de sécurité ANSI Z49.1 et Z87.1).
- Porter des lunettes de sécurité à écrans latéraux sous le masque.
- Utiliser des écrans ou des barrières pour protéger les tiers de l'éclat éblouissant ou aveuglant de l'arc ; leur demander de ne pas regarder l'arc.
- Porter des vêtements de protection en matière durable et ignifuge (cuir ou laine) et des chaussures de sécurité.



### LE SOUDAGE peut causer un incendie ou une explosion.

Le soudage effectué sur des récipients fermés tels que des réservoirs, des fûts ou des conduites peut causer leur éclatement. Des étincelles peuvent être projetées de l'arc de soudure. La projection d'étincelles, les pièces chaudes et les équipements chauds peuvent causer des incendies et des brûlures. Le contact accidentel de l'électrode avec tout objet métallique peut causer des étincelles, une explosion, un surchauffement ou un incendie. Avant de commencer le soudage, vérifier et s'assurer que l'endroit ne présente pas de danger.

- Se protéger et protéger les tiers de la projection d'étincelles et de métal chaud.
- Ne pas souder à un endroit où des étincelles peuvent tomber sur des substances inflammables.
- Placer toutes les substances inflammables à une distance de 10,7 m de l'arc de soudage. En cas d'impossibilité, les recouvrir soigneusement avec des protections agréées.
- Des étincelles et des matières en fusion peuvent facilement passer même par des fissures et des ouvertures de petites dimensions.
- Surveiller tout déclenchement d'incendie et tenir un extincteur à proximité.
- Le soudage effectué sur un plafond, un plancher, une paroi ou une cloison peut déclencher un incendie de l'autre côté.
- Ne pas souder des récipients fermés tels que des réservoirs, des fûts ou des conduites, à moins qu'ils n'aient été préparés conformément à l'AWS F4.1 (voir les normes de sécurité).
- Brancher le câble sur la pièce la plus près possible de la zone de soudage pour éviter que le courant ne circule sur une longue distance, par des chemins inconnus, et ne cause des risques d'électrocution et d'incendie.
- Ne pas utiliser le poste de soudage pour dégeler des conduites gelées.
- En cas de non utilisation, enlever la baguette d'électrode du porte-électrode ou couper le fil au raz du tube-contact.
- Porter des vêtements de protection exempts d'huile tels que des gants en cuir, une chemise en tissu épais, des pantalons sans revers, des chaussures montantes et un masque.
- Avant de souder, retirer tout produit combustible de ses poches, tel qu'un briquet au butane ou des allumettes.

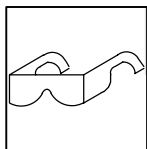

### LES PARTICULES PROJETÉES peuvent blesser les yeux.

- Le soudage, le burinage, le passage de la pièce à la brosse métallique et le meulage provoquent l'émission d'étincelles et de particules métalliques. Pendant leur refroidissement, les soudures risquent de projeter du laitier.
- Porter des lunettes de sécurité à écrans latéraux agréés, même sous le masque de soudage.




### LES ACCUMULATIONS DE GAZ peuvent causer des blessures ou même la mort.

- Couper l'alimentation en gaz protecteur en cas de non utilisation.
- Veiller toujours à bien ventiler les espaces confinés ou porter un respirateur à adduction d'air agréé.




### LES PIÈCES CHAUDES peuvent causer des brûlures graves.

- Ne pas toucher les pièces chaudes à main nue.
- Prévoir une période de refroidissement avant d'utiliser le pistolet ou la torche.

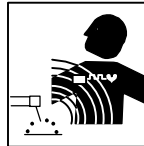

### LES CHAMPS MAGNÉTIQUES peuvent perturber le fonctionnement des stimulateurs cardiaques.


- Les personnes qui portent un stimulateur cardiaque doivent se tenir à distance.
- Ils doivent consulter leur médecin avant de s'approcher d'un lieu où on exécute des opérations de soudage à l'arc, de gougeage ou de soudage par points.

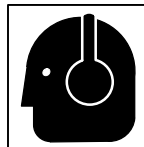

### LE BRUIT peut affecter l'ouïe.

Le bruit de certains processus et équipements peut affecter l'ouïe.

- Porter des protecteurs d'oreille agréés si le niveau sonore est trop élevé.

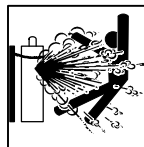

### Les BOUTEILLES endommagées peuvent exploser.

Les bouteilles de gaz protecteur contiennent du gaz sous haute pression. Toute bouteille endommagée peut exploser. Comme les bouteilles de gaz font normalement partie du procédé de soudage, les manipuler avec précaution.

- Protéger les bouteilles de gaz comprimé de la chaleur excessive, des chocs mécaniques, du laitier, des flammes nues, des étincelles et des arcs.
- Placer les bouteilles debout en les fixant dans un support stationnaire ou dans un porte-bouteilles pour les empêcher de tomber ou de se renverser.
- Tenir les bouteilles éloignées des circuits de soudage ou autres circuits électriques.
- Ne jamais poser une torche de soudage sur une bouteille de gaz.
- Ne jamais mettre une électrode de soudage en contact avec une bouteille de gaz.
- Ne jamais souder une bouteille contenant du gaz sous pression – elle risquerait d'exploser.
- N'utiliser que les bouteilles de gaz protecteur, régulateurs, tuyaux et raccords adéquats pour l'application envisagée ; les maintenir en bon état, ainsi que les pièces connexes.
- Détourner la tête lorsqu'on ouvre la soupape d'une bouteille.
- Laisser le capuchon protecteur sur la soupape, sauf en cas d'utilisation ou de branchement de la bouteille.
- Lire et suivre les instructions concernant les bouteilles de gaz comprimé, les équipements associés et les publications P-1 de la CGA, mentionnées dans les normes de sécurité.

## 2-3. Autres symboles relatifs à l'installation, au fonctionnement et à l'entretien de l'appareil.




### Risque D'INCENDIE OU D'EXPLOSION

- Ne pas placer l'appareil sur une surface inflammable, ni au-dessus ou à proximité d'elle.
- Ne pas installer l'appareil à proximité de produits inflammables.
- Ne pas surcharger l'installation électrique – s'assurer que l'alimentation est correctement dimensionnée et protégée avant de mettre l'appareil en service.




### LA CHUTE DE L'APPAREIL peut blesser.

- N'utiliser que l'anneau de levage pour lever l'appareil. NE PAS utiliser le chariot, les bouteilles de gaz ou tout autre accessoire.
- Utiliser un engin de capacité adéquate pour lever l'appareil.
- Si on utilise un chariot élévateur pour déplacer l'unité, s'assurer que les fourches sont suffisamment longues pour dépasser du côté opposé de l'appareil.

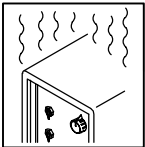

### L'EMPLOI EXCESSIF peut FAIRE SURCHAUFFER L'ÉQUIPEMENT.

- Prévoir une période de refroidissement ; respecter le cycle opératoire nominal.
- Réduire le courant ou le cycle opératoire avant de reprendre le soudage.
- Ne pas obstruer les orifices ou filtrer l'alimentation en air du poste.

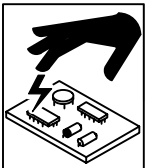

### LES CHARGES ÉLECTROSTATIQUES peuvent endommager les circuits imprimés.

- Mettre un bracelet antistatique AVANT de manipuler des cartes ou des pièces.
- Utiliser des pochettes et des boîtes antistatiques pour stocker, déplacer ou expédier des cartes de circuits imprimés.



### LES PIÈCES MOBILES peuvent causer des blessures.

- Se tenir à l'écart des pièces mobiles.
- Se tenir à l'écart des points de coincement tels que les dévidoirs.




### LES FILS DE SOUDAGE peuvent causer des blessures.

- Ne pas appuyer sur la gâchette avant d'en avoir reçu l'instruction.
- Ne pas diriger le pistolet vers soi, vers d'autres personnes ou vers toute pièce mécanique en engageant le fil de soudage.




### LES ORGANES MOBILES peuvent causer des blessures.

- Se tenir à l'écart des organes mobiles comme les ventilateurs.
- Maintenir fermés et bien fixés les portes, panneaux, recouvrements et dispositifs de protection.

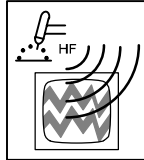


### LE RAYONNEMENT HAUTE FRÉQUENCE (H. F.) risque de causer des interférences.

- Le rayonnement haute fréquence peut causer des interférences avec les équipements de radio-navigation et de communication, les services de sécurité et les ordinateurs.
- Ne demander qu'à des personnes qualifiées familiarisées avec les équipements électroniques de faire fonctionner l'installation.
- L'utilisateur est tenu de faire corriger rapidement par un électricien qualifié les interférences causées par l'installation.
- Si la Federal Communications Commission signale des interférences, arrêter immédiatement l'appareil.
- Faire régulièrement contrôler et entretenir l'installation.
- Maintenir soigneusement fermés les panneaux et les portes des sources de haute fréquence, maintenir le jeu d'éclatement au réglage adéquat et utiliser une terre et un blindage pour réduire les interférences éventuelles.

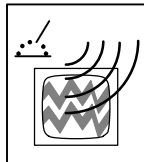

### LE SOUDAGE À L'ARC peut causer des interférences.

- L'énergie électromagnétique peut causer des interférences avec l'équipement électronique sensible tel que les ordinateurs et l'équipement commandé par ordinateur tel que les robots.
- Veiller à ce que tout l'équipement de la zone de soudage soit compatible au point de vue électromagnétique.
- Pour réduire la possibilité d'interférence, maintenir les câbles de soudage aussi courts que possible, les grouper, et les poser aussi bas que possible (par ex. : à terre).
- Veiller à souder à une distance de 100 mètres de tout équipement électronique sensible.
- Veiller à ce que le poste de soudage soit posé et mis à la terre conformément au présent manuel.
- En cas d'interférences après exécution des directives précédentes, il incombe à l'utilisateur de prendre des mesures supplémentaires telles que le déplacement du poste, l'utilisation de câbles blindés, l'utilisation de filtres de ligne ou la pose de protecteurs dans la zone de travail.

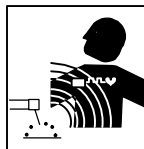

### LES CHAMPS MAGNÉTIQUES peuvent affecter les stimulateurs cardiaques.

- Porteurs de stimulateur cardiaque, restez à distance.
- Les porteurs d'un stimulateur cardiaque doivent d'abord consulter leur médecin avant de s'approcher des opérations de soudage à l'arc, de gougeage ou de soudage par points.

## 2-4. Principales normes de sécurité

Safety in Welding, Cutting, and Allied Processes, norme ANSI Z49.1, de l'American Welding Society, 550 N.W. LeJeune Rd, Miami FL 33126 (téléphone : (305) 443-9353, site Web : [www.aws.org](http://www.aws.org)).

Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping, norme American Welding Society AWS F4.1, de l'American Welding Society, 550 N.W. LeJeune Rd, Miami, FL 33126 (téléphone : (305) 443-9353, site Web : [www.aws.org](http://www.aws.org)).

National Electrical Code, norme NFPA 70, de la National Fire Protection Association, P.O. Box 9101, 1 Battery March Park, Quincy, MA 02269-9101 (téléphone : (617) 770-3000, sites Web : [www.nfpa.org](http://www.nfpa.org) et [www.sparky.org](http://www.sparky.org)).

Safe Handling of Compressed Gases in Cylinders, brochure CGA P-1, de la Compressed Gas Association, 1735 Jefferson Davis Highway, Suite 1004, Arlington, VA 22202-4102 (téléphone : (703) 412-0900, site Web : [www.cganet.com](http://www.cganet.com)).

Code for Safety in Welding and Cutting, norme CSA W117.2, de la Canadian Standards Association, Standards Sales, 178 boulevard

Rexdale, Rexdale (Ontario) Canada M9W 1R3 (téléphone : (800) 463-6727 ou à Toronto : (416) 747-4044, site Web : [www.csa-international.org](http://www.csa-international.org)).

Practice For Occupational And Educational Eye And Face Protection, norme ANSI Z87.1, de l'American National Standards Institute, 11 West 42nd Street, New York, NY 10036-8002 (téléphone : (212) 642-4900, site Web : [www.ansi.org](http://www.ansi.org)).

Standard for Fire Prevention During Welding, Cutting, and Other Hot Work, norme NFPA 51B, de la National Fire Protection Association, P.O. Box 9101, 1 Battery March Park, Quincy, MA 02269-9101 (téléphone : (617) 770-3000, site Web : [www.nfpa.org](http://www.nfpa.org) et [www.sparky.org](http://www.sparky.org)).

OSHA, Occupational Safety and Health Standards for General Industry, Title 29, Code of Federal Regulations (CFR), Part 1910, Subpart Q, and Part 1926, Subpart J, de l'U.S. Government Printing Office, Superintendent of Documents, P.O. Box 371954, Pittsburgh, PA 15250 (il y a 10 bureaux régionaux – Téléphone pour la Région 5, Chicago : (312) 353-2220, site Web : [www.osha.gov](http://www.osha.gov)).

## 2-5. Information sur les champs électromagnétiques

Données sur le soudage électrique et les effets des champs magnétiques basse fréquence sur l'organisme

En parcourant les câbles de soudage, le courant crée des champs électromagnétiques. Les effets potentiels de tels champs restent préoccupants. Cependant, après avoir examiné plus de 500 études qui ont été faites pendant une période de recherche de 17 ans, un comité de spécialistes du National Research Council a conclu : « L'accumulation de preuves n'a pas démontré que l'exposition aux champs magnétiques et aux champs électriques à haute fréquence constitue un risque pour la santé humaine ». Toutefois, les études et l'examen des preuves se poursuivent. En attendant les conclusions finales de la recherche, il serait souhaitable de réduire l'exposition aux champs électromagnétiques pendant le soudage ou le coupage.

Afin de réduire les champs électromagnétiques en milieu de travail, respecter les consignes suivantes :


 








1. Garder les câbles ensemble en les torsadant ou en les fixant avec du ruban adhésif.
2. Mettre tous les câbles du côté opposé à l'opérateur.
3. Ne pas s'enrouler les câbles autour du corps.
4. Garder le poste de soudage et les câbles le plus loin possible de soi.
5. Placer la pince de masse le plus près possible de la zone de soudage.

### Consignes relatives aux stimulateurs cardiaques :

Les personnes qui portent un stimulateur cardiaque doivent avant tout consulter leur médecin. Si ce dernier les déclare aptes, il leur est recommandé de respecter les consignes ci-dessus.


## SECTION 3 – DEFINITIONS

### 3-1. Symbols And Definitions

<b>A</b>	Amperes	1~ Single Phase	 Do Not Switch Under Load	 Input
<b>I</b>	On	<b>O</b> Off	 Output	<b>Hz</b> Hertz
	Alternating Current	 Electrode Positive	 Electrode Negative	 Direct Current
	Welding Arc	<b>V</b> Volts	 Work	 Electrode

### 3-2. Manufacturer's Rating Labels

Rating Label For EN/FR Machines

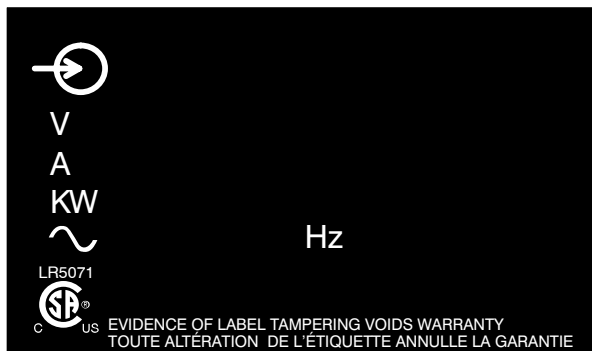

Rating Label For All Other Machines



217 652-A / 165 371-A

# SECTION 4 – INSTALLATION

## 4-1. Specifications

### AC/DC Models


Mode	Rated Welding Output	Amperage Range	Maximum Open-Circuit Voltage	Amperes Input at Rated Load Output 50 Or 60 Hz, Single-Phase					Weight
				115 V	220 V	230 V	400 V	460 V	
AC	225 A @ 25 Volts AC, 20% Duty Cycle @ 60 Hz; 15% Duty Cycle @ 50 Hz	Low: 30 – 150 High: 40 – 235	80 VAC	95 4.6*		47.5 2.3*		23.7 1.2*	104 lb (47 kg)
DC	150 A @ 25 Volts DC, 20% Duty Cycle @ 60 Hz; 15% Duty Cycle @ 50 Hz	30 – 160	80 VDC						
AC	300 A @30 Volts AC, 20% Duty Cycle @ 50/60 Hz	Low: 40 – 200 High: 65 – 300	80 VAC		70 5.4*	67 3.6*	39 1.8*	34 1.3*	134 lbs (61 kg)
DC	200 A @ 25 Volts DC, 20% Duty Cycle @ 50/60 Hz	30 – 200	80 VDC						
Overall Dimensions									
Height: 18-3/4 in (476 mm); Width: 12-3/4 in (323 mm); Depth: 17-1/2 in (445 mm)									
*While idling									

### AC Models


Rated Welding Output	Amperage Range	Max Open-Circuit Voltage	Amperes Input at Rated Load Output 50 Or 60 Hz, Single-Phase				KW	Weight
			115 V	220 V	230 V	400 V		
225 A @ 25 Volts AC, 20% Duty Cycle @ 60 Hz; 15% Duty Cycle @ 50 Hz	Low: 30 – 150A High: 40 – 235A	80 VAC	95 4.6*		47.5 2.3*		7.2 0.22*	85 lb (39 kg)
300 A @ 30 Volts AC, 20% Duty Cycle @ 50/60 Hz	Low: 40 – 200 High: 65 – 300	80 VAC		70 5.4*	67 3.6*	39 1.8*	11.5 0.22*	107 lb (49 kg)
<b>Overall Dimensions</b>								
Height: 18-3/4 in (476 mm); Width: 12-3/4 in (323 mm); Depth: 17-1/2 in (445 mm)								
*While idling								

## 4-2. Duty Cycle Charts

### A. For AC/DC Models

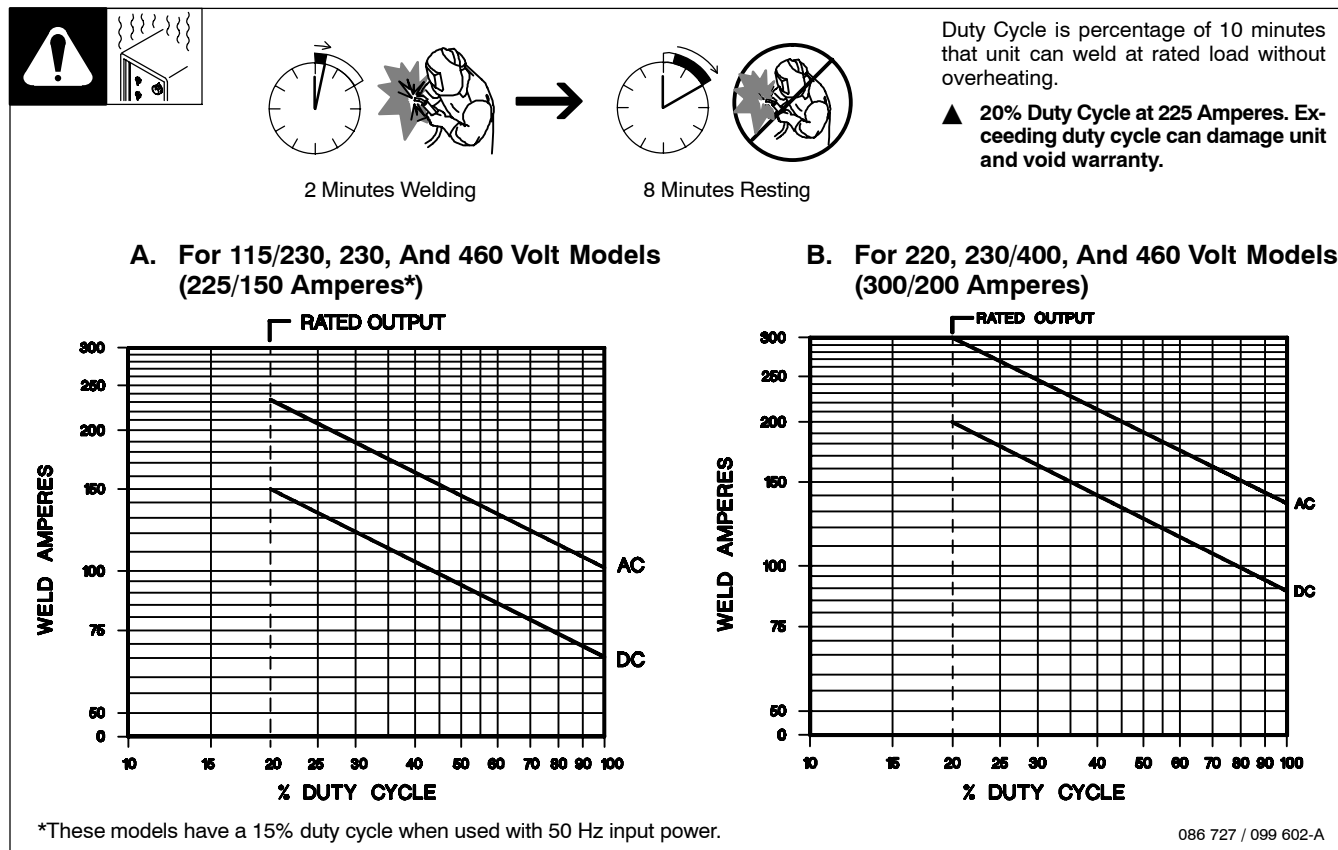

### B. For AC Models


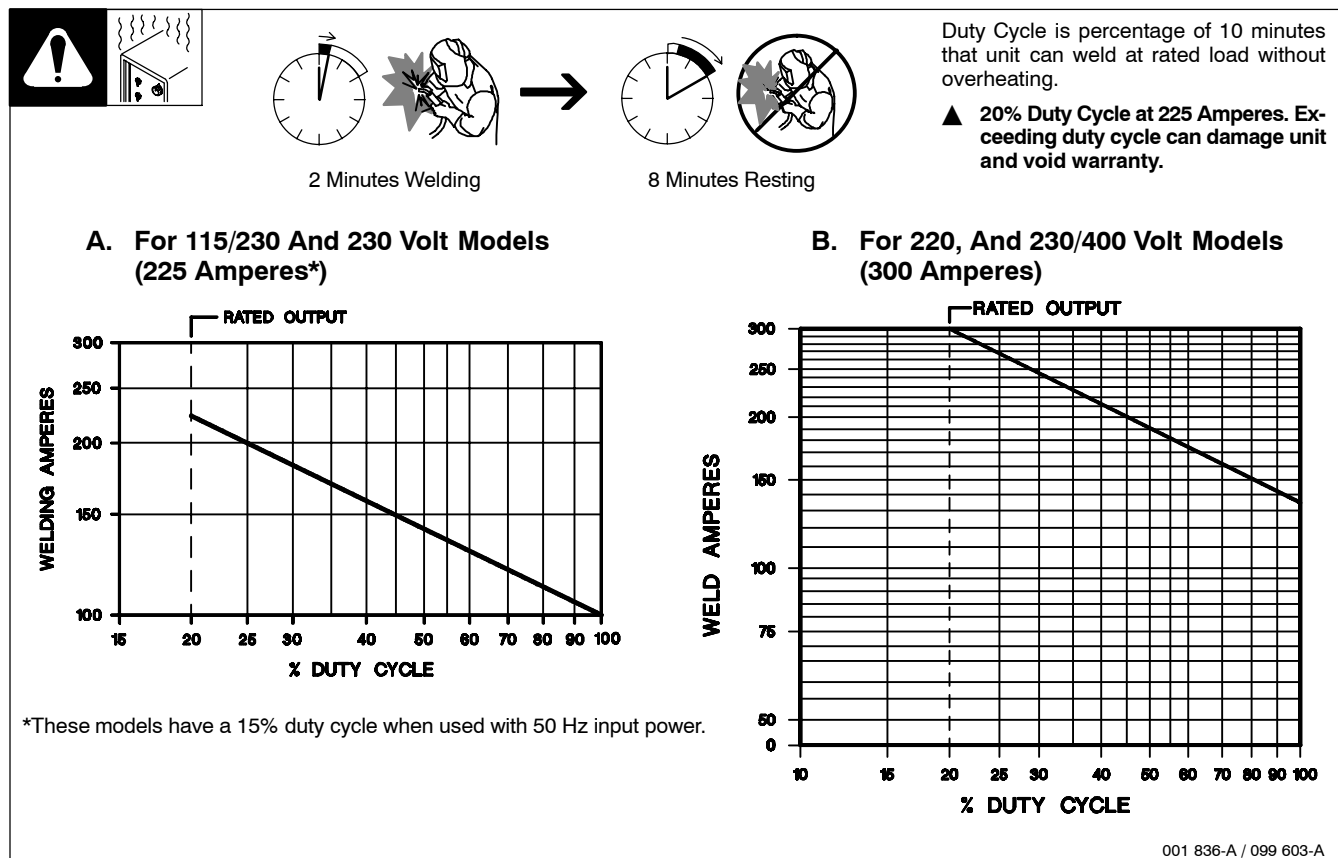


4-3. Volt-Ampere Curves



A. For AC/DC Models

The volt-ampere curves show the minimum and maximum voltage and amperage output capabilities. Curves of other settings fall between the curves shown.

A. For 115/230, 230 And 460 Volt Models  
(225/150 Amperes)

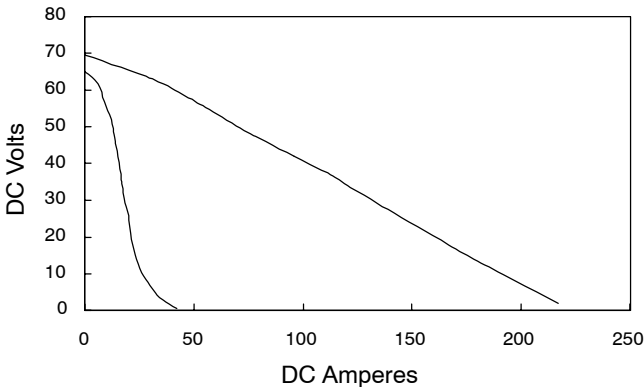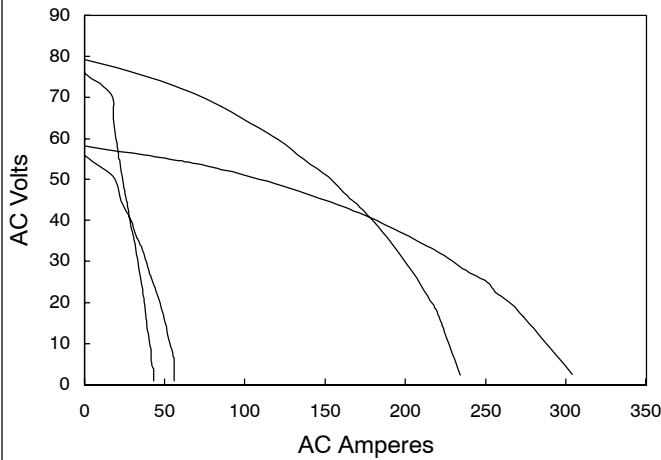

B. For 220, 230/400, And 460 Volt Models  
(300/200 Amperes)

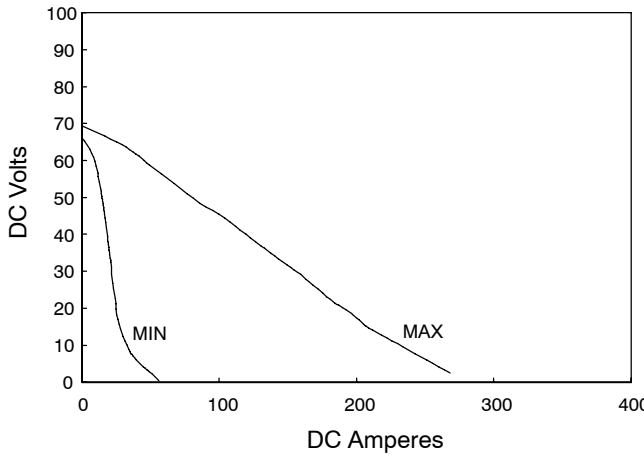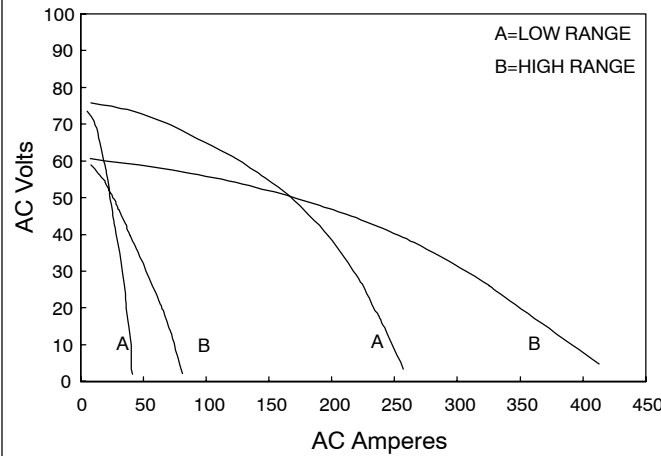





**B. For AC Models**

The volt-ampere curves show the minimum and maximum voltage and amperage output capabilities. Curves of other settings fall between the curves shown.


**A. For 115/230 And 230 Volt Models  
(225 Amperes)**

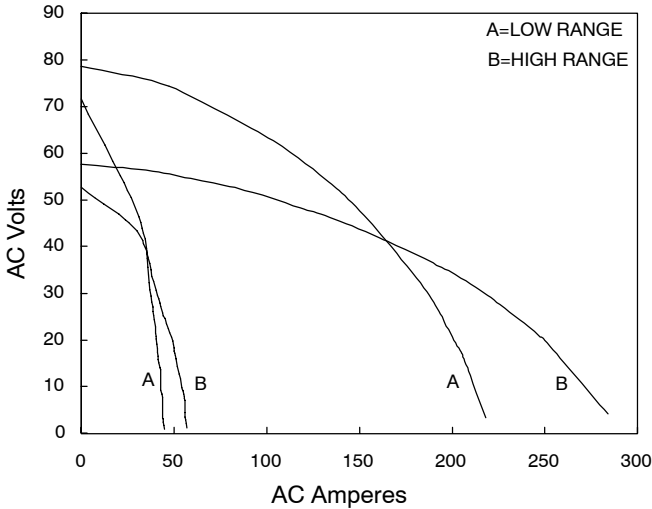

**B. For 220 Volt Model  
(300 Amperes)**

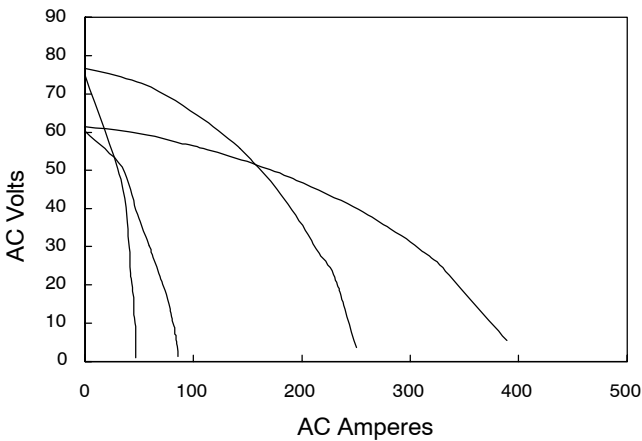


**C. For 230/400 Volt Model  
(300 Amperes)**

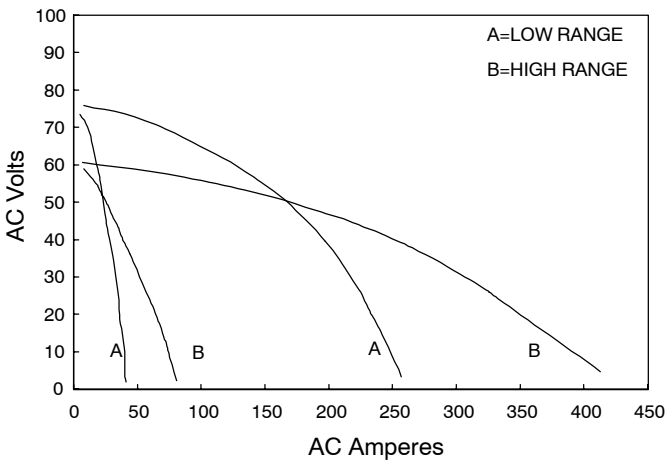


193 508 / 193 513 / 193 511


## 4-4. Selecting A Location

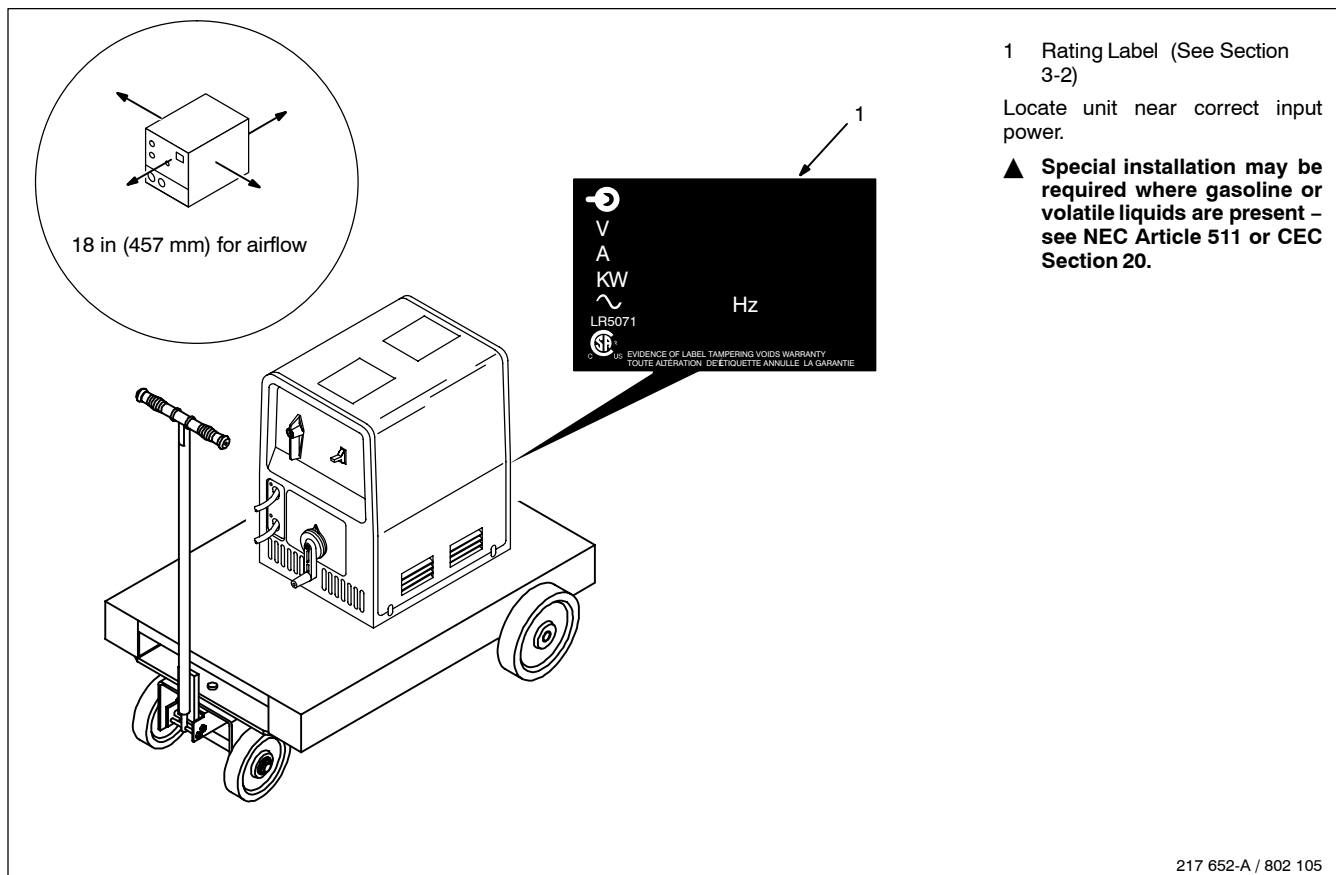

## 4-5. Installing Electrode Holder And Work Clamp

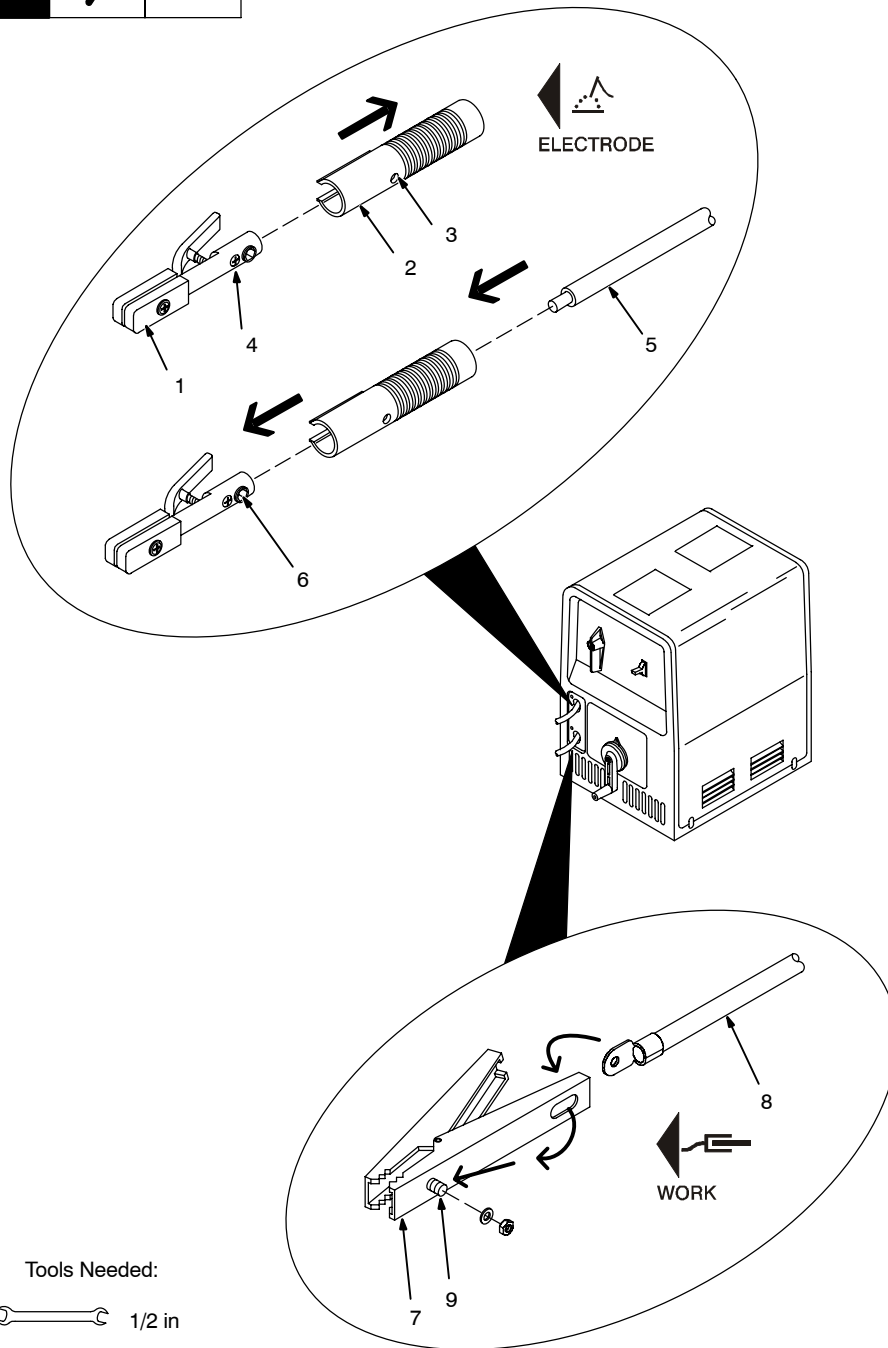

Tools Needed:

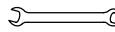 1/2 in

 1/4 in



▲ Turn Off unit and disconnect input power before installing electrode holder or work clamp.

### Removing Barrel From Electrode Holder

- 1 Electrode Holder
- 2 Barrel
- 3 Access Hole
- 4 Set Screw

Loosen set screw through access hole and slide barrel away from electrode holder.

### Installing Electrode Cable and Barrel onto Electrode Holder

- 5 Electrode Cable From Unit (Has Bare Conductors on End)
- 6 Terminal Screw

Back out terminal screw from electrode holder. Insert electrode cable through barrel into end of electrode holder and tighten terminal screw securely.

Move barrel toward electrode holder and tighten set screw to secure barrel in place.

### Installing Work Cable onto Work Clamp

- 7 Work Clamp
- 8 Work Cable From Unit (Has Ring Terminal on End)
- 9 Mounting Bolt

Route work cable through work clamp as shown and install onto mounting bolt using supplied hardware.

802 251 / 802 105-C

## 4-6. Weld Output Cables

**NOTE** 

For weld output cable replacements or extensions, contact your Factory Authorized Service Agent.


## 4-7. Electrical Service Guide

<b>Input Voltage</b>	115	220	230	400	460
<b>Input Amperes At Rated Output</b>	95	[70]	47.5 [67]	[39]	23.7 [34]
<b>Max Recommended Standard Fuse Or Circuit Breaker Rating In Amperes</b>	150	[110]	70 [100]	[60]	35 [50]
<b>Min Input Conductor Size In AWG/Kcmil</b>	8	[8]	12 [10]	[14]	14 [14]
<b>Max Recommended Input Conductor Length In Feet (Meters)</b>	32 (10)	[75 (23)]	87 (26) [82 (25)]	[101 (31)]	138 (42) [87 (27)]
<b>Min Grounding Conductor Size In AWG/Kcmil</b>	8	[8]	12 [10]	[14]	14 [14]
[ ] Electrical Service Requirements For 300/200 AC/DC And 300 AC Models					
Reference: 1997 National Electrical Code (NEC)				Ref. S-0092-J	

## 4-8. Internal Connections For Operating 115/230 Volts, 225 Amperes AC And AC/DC Models From 115 Volts

### NOTE

Follow applicable electrical codes and have a competent electrician make internal connections. Note the input amperes as stated in Section 4-7.

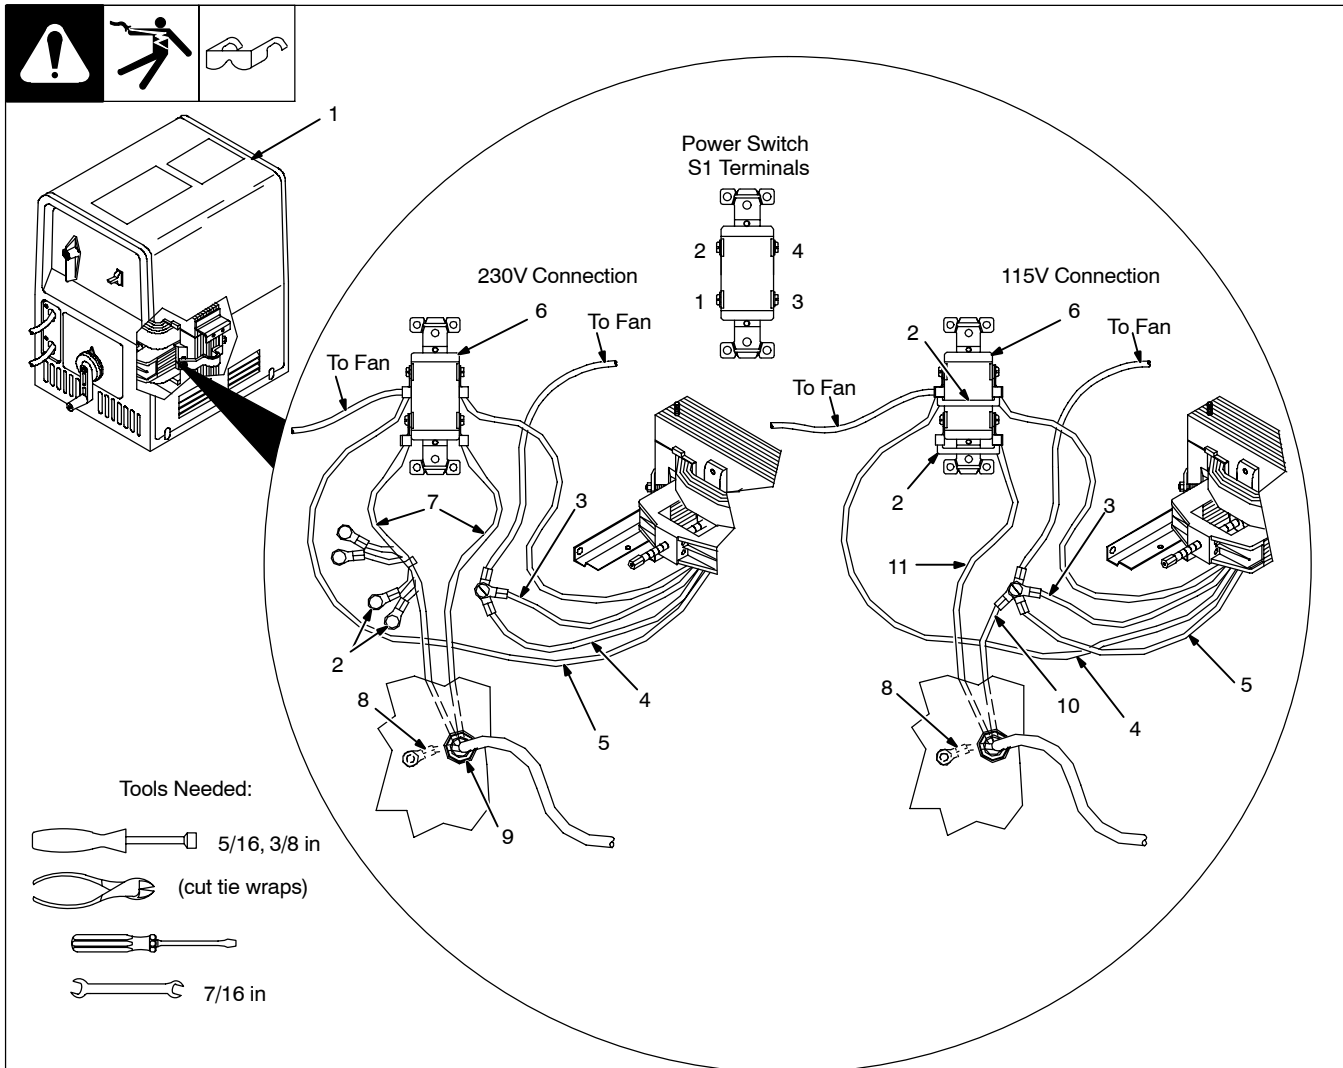

Ref. 802 247-E

#### ▲ Turn Off unit and disconnect input power.

##### 1 Wrapper

Remove wrapper.

##### 2 Jumper Leads

Cut tie wrap securing jumper leads to power cord lead and remove jumper leads.

##### 3 Lead 2

##### 4 Lead 3

Remove insulated sleeving, and disconnect lead 2 from lead 3.

##### 5 Lead 4

Disconnect lead 4 from terminal 2 on S1.

Connect lead 3 and one end of jumper lead to terminal 2.

Connect other end of jumper lead to terminal

4 on S1. Be sure existing connection to that terminal remains.

##### 7 230 V Input Power Cord Black Leads

 
Disconnect input power cord black leads from S1, and disconnect green ground lead from ground terminal on rear panel.

##### 9 Input Power Cord Strain Relief

Loosen strain relief, and remove 230 volt input power cord.

Obtain correct size and length 115 volt input power cord (see Section 4-7). Install correct size ring terminals to cord leads.

Route cord through strain relief, and connect green lead to ground terminal.

 To install large power cords, remove knock-out located on lower rear panel of unit, insert power cord, and install plug into original power cord hole.

#### ▲ Make sure paint has been removed from area where ground terminal is secured on unit.

##### 10 115 V Input Power Cord White Lead

Connect lead 2, lead 4, and white input power cord lead together, and secure with existing hardware. Reinstall insulated sleeving.

##### 11 115 V Input Power Cord Black Lead

Connect black input power cord lead and jumper lead to terminal 3 on S1.

Connect other end of jumper lead to terminal 1 on S1.

Use tie-wraps to secure all leads away from transformer, stabilizer and fan. Be sure leads are clear of movable shunt.


Tighten strain relief, and install wrapper.

Connect input power according to Section 4-10.

## 4-9. Internal Connections For Operating 230/400 Volts, 300/200 Amperes AC/DC Or 300 Amperes AC Models From 230 Volts

### NOTE

Follow applicable electrical codes and have a competent electrician make internal connections. Note the input amperes as stated in Section 4-7.

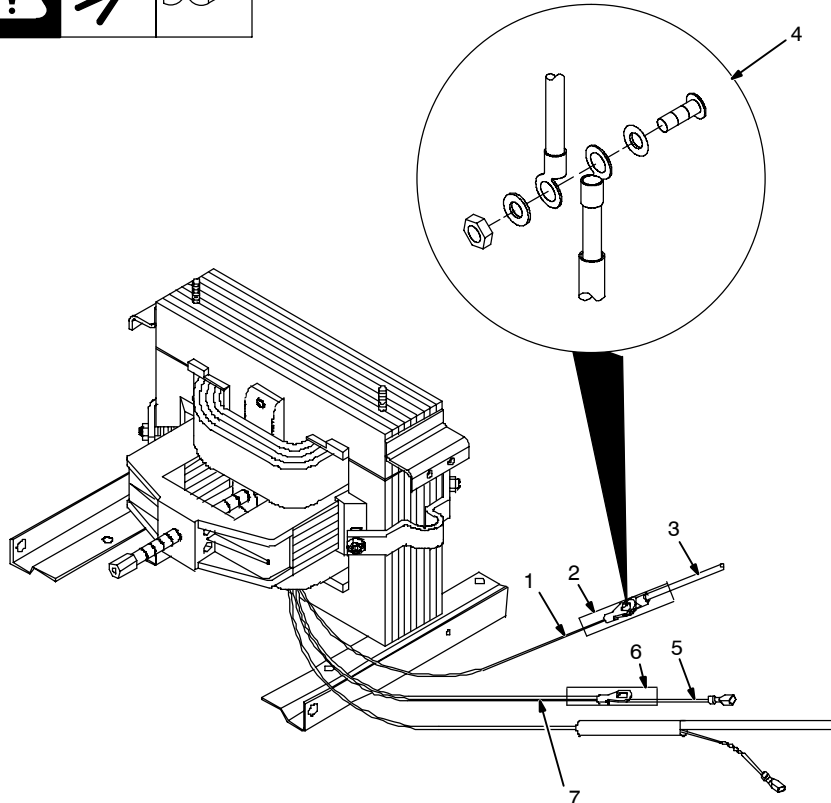

Connected For 400 Volts

### ▲ Turn Off unit and disconnect input power.

- 1 Primary Coil Lead 4
- 2 Lead 4 Insulation Sleeve
- 3 Power Switch Lead 4
- 4 Lead Connection Hardware

Slide Sleeve down, and disconnect one lead 4 from the other. Remove sleeve.

- 5 Fan Motor (FM) Lead 2
- 6 Lead 2 Insulation Sleeve

Disconnect fan motor lead 2 at fan motor, and remove sleeve.

Take lead 2 sleeve and secure it over the end of primary coil lead 4.


Replace lead 2 sleeve with lead 4 sleeve.

- 7 Primary Coil Lead 2

Slide sleeve out of the way, and connect power switch Lead 4 to primary coil lead 2, and secure with existing hardware. Secure sleeve over connection.

Connect fan motor lead 2 back onto fan motor.

Reinstall wrapper.

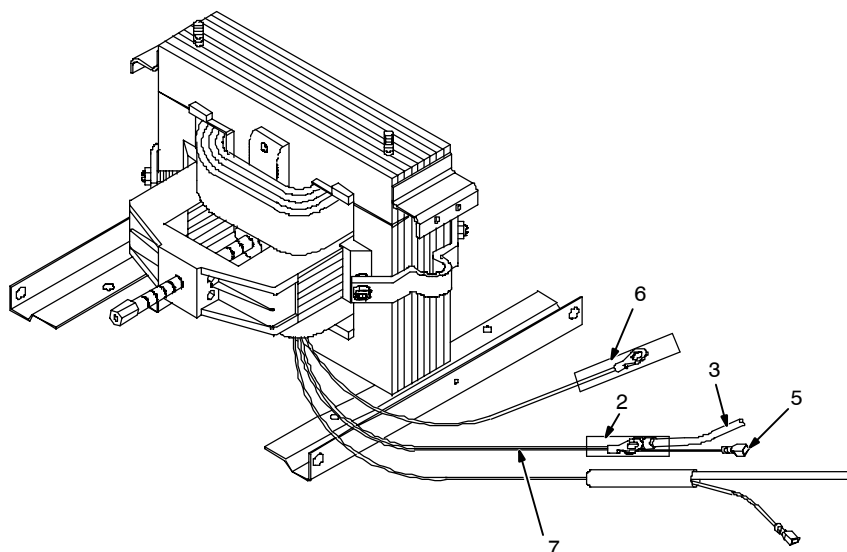

Connected For 230 Volts

### Tools Needed:




5/16, 3/8 in



(cut tie wraps)

## 4-10. Connecting Input Power

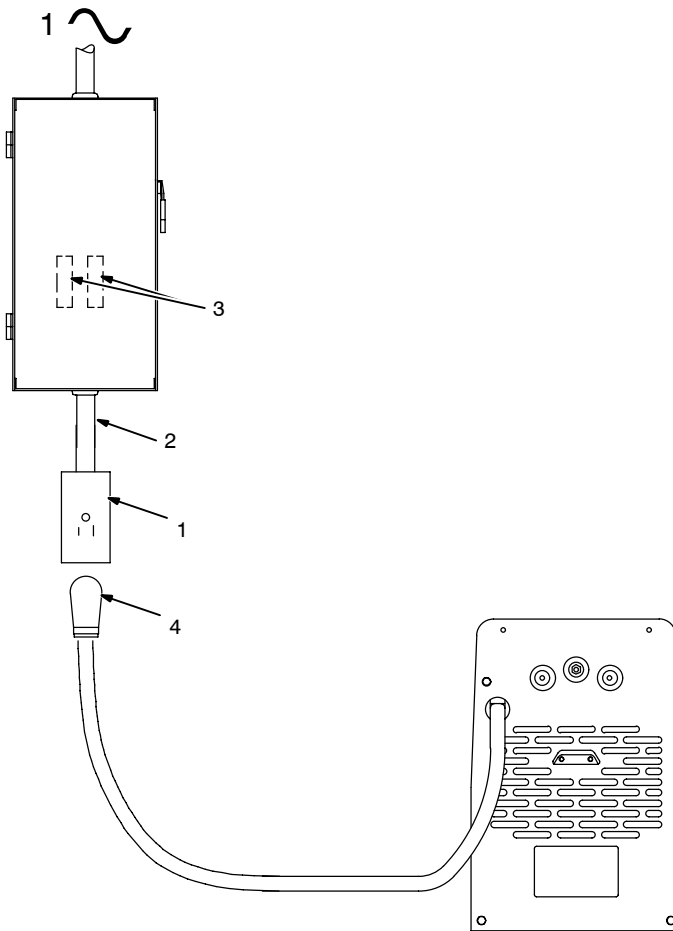

### For Models Supplied With Plug

▲ **Disconnect and lockout/tag-out input power before installing receptacle.**

▲ **Have only qualified persons make this installation. See rating label in Section 4-4, and be sure to supply correct input power.**

- 1 Proper Receptacle (User-Supplied)

Receptacle must comply with applicable codes.

- 2 Input And Grounding Conductors

See size and length using Section 4-7. Conductors must comply with applicable codes.


- 3 Over-Current Protection

Select type and size of over-current protection using Section 4-7.

- 4 Plug

Connect plug to properly installed receptacle.

Or

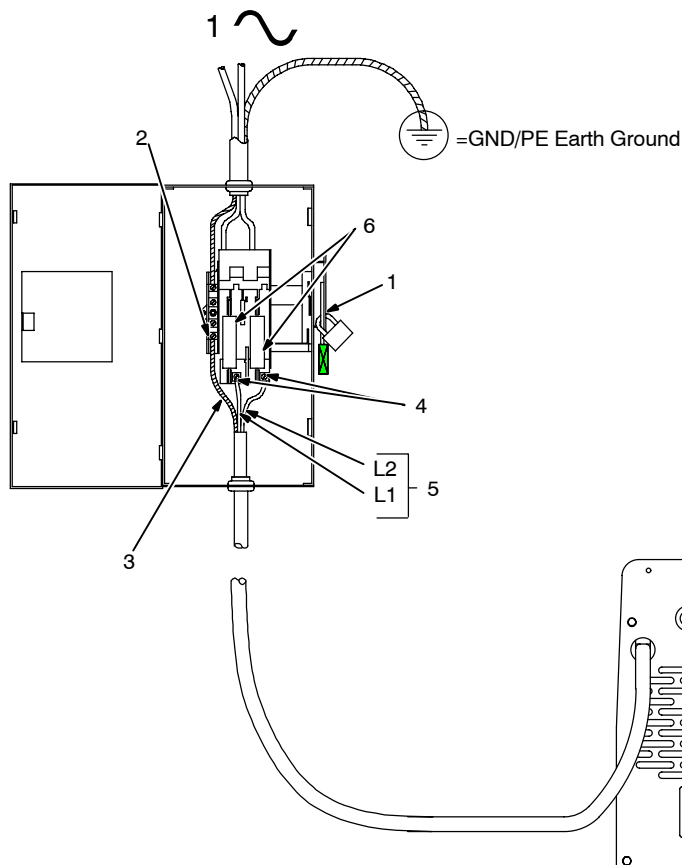

### For Models Not Supplied With Plug

▲ **Installation must meet all National and Local Codes – have only qualified persons make this installation.**

▲ **Disconnect and lockout/tagout input power before connecting input conductors from unit.**

▲ **Always connect green or green/yellow conductor to supply grounding terminal first, and never to a line terminal.**

- 1 Line Disconnect Device (Switch Shown In Off Position)
- 2 Disconnect Device Grounding Terminal
- 3 Green Or Green/Yellow Grounding Conductor

Connect green or green/yellow grounding conductor to disconnect device grounding terminal first.

- 4 Disconnect Device Line Terminals
- 5 Black And White Input Conductors L1 And L2

Connect input conductors L1 and L2 to disconnect device line terminals.

- 6 Over-Current Protection

 
Select type and size of over-current protection using Section 4-7 (fused disconnect switch shown).

Close and secure door on disconnect device. Remove lockout/tagout device, and place switch in the On position.


Ref. 802 246

# SECTION 5 – OPERATION

## 5-1. Controls



### A. Controls For AC/DC Models

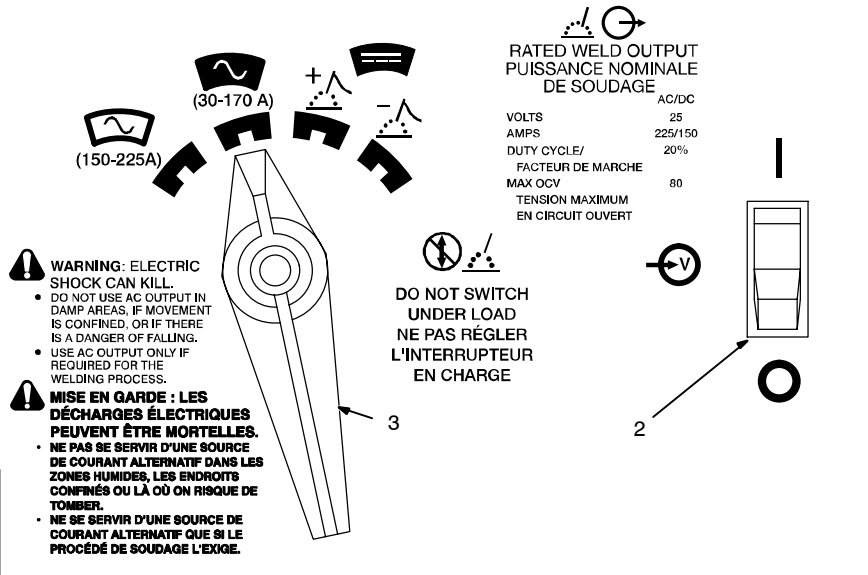



- 1 Amperage Adjustment Control
- 2 Power Switch
- 3 Mode Switch

#### For DC Weld Output

Use mode switch to select polarity of dc output, Electrode Positive/DCEP (+), or Electrode Negative/DCEN (-).


#### For AC Weld Output

Use mode switch to select ac low range or high range output.

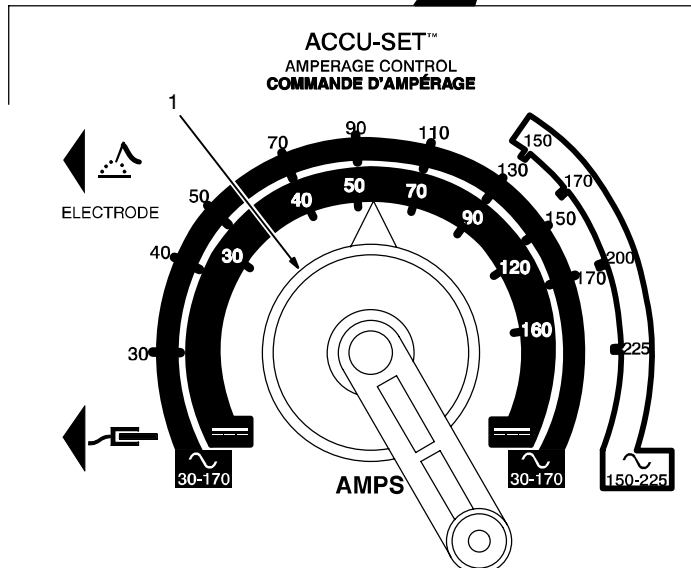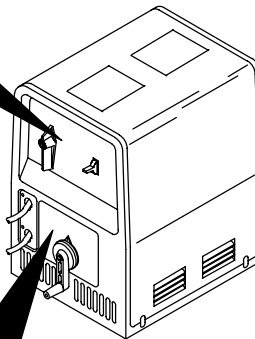





## B. Controls For AC Models

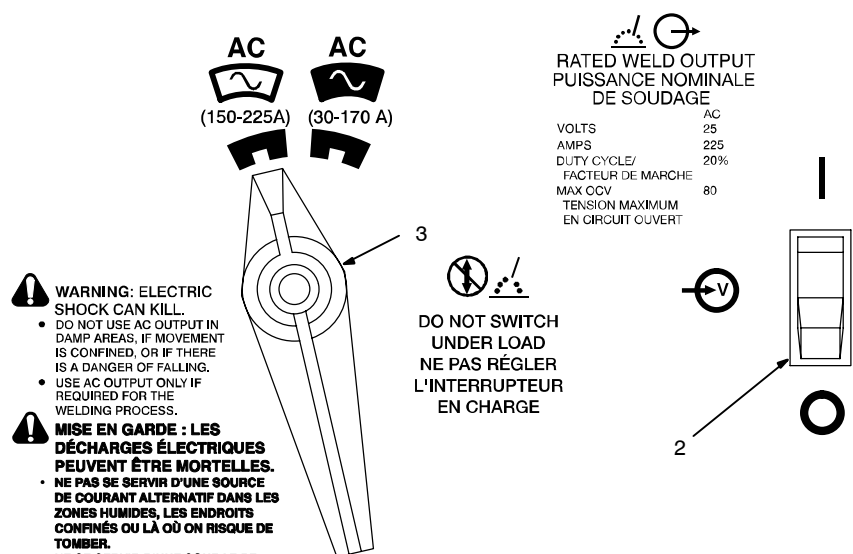






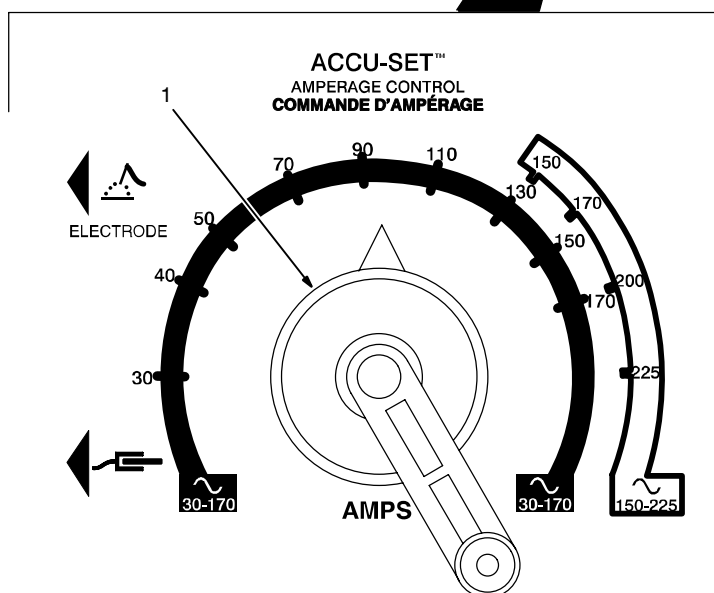
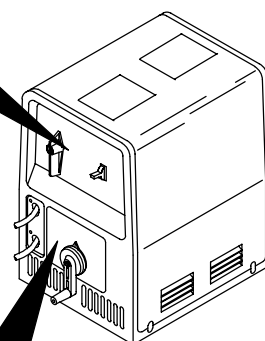




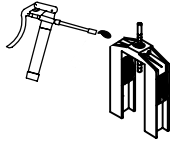
- 1 Amperage Adjustment Control
- 2 Power Switch
- 3 Mode Switch

Use mode switch to select ac low range or high range output.

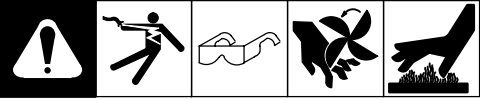
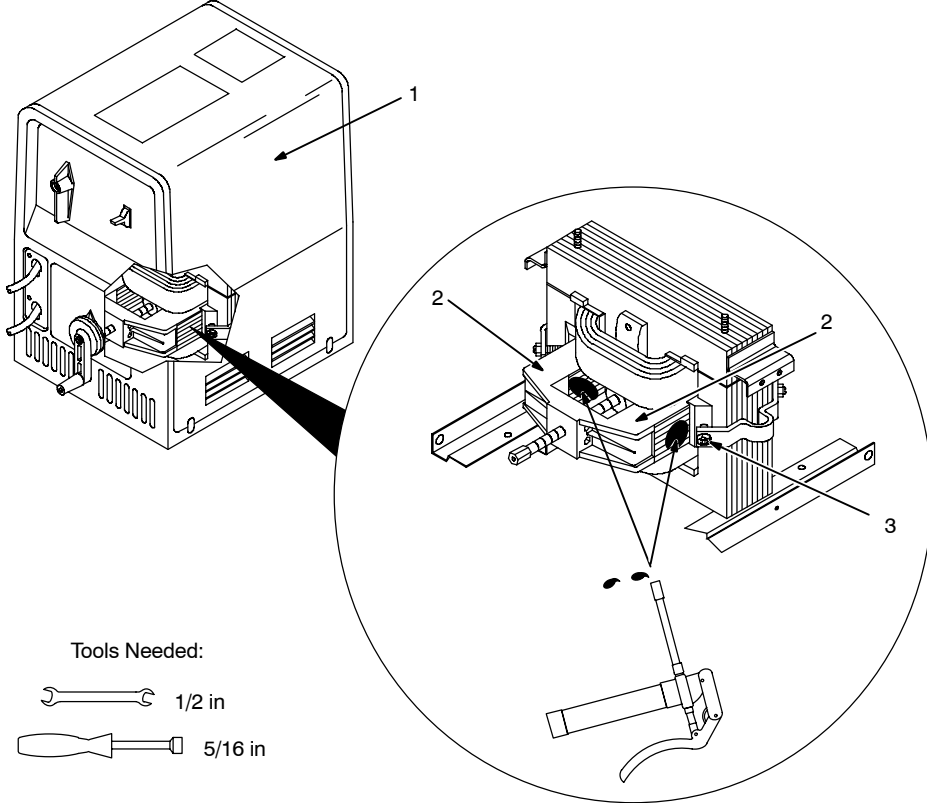


# SECTION 6 – MAINTENANCE & TROUBLESHOOTING

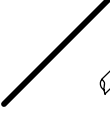
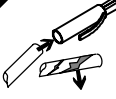
## 6-1. Routine Maintenance

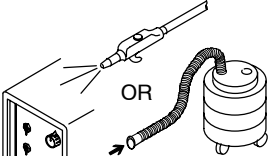					<p>▲ Disconnect power before maintaining.</p>				
					<p> <b>3 Months</b></p>				
 			<p>Replace Unreadable Labels</p>		  			<p>Repair Or Replace Cracked Cables</p>	
			<p> <b>6 Months</b></p>					<p> <b>12 Months</b></p>	
 <p>OR</p> 			<p>Blow Out Or Vacuum Inside, During Heavy Service, Clean Monthly</p>					<p>Lubricate Shunt Block (See Section 6-2)</p>	

## 6-2. Lubricating Shunt Block And Anti-Noise Adjustment



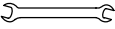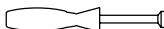

**Tools Needed:**

-  1/2 in
-  5/16 in

▲ Turn Off welding power source and disconnect input power.

- 1 Wrapper  
Remove wrapper.
- 2 Shunt Block

 Do not grease screw threads on shunt block.

Apply light coating of high-temperature grease to shaded areas of both shunt blocks. Turn amperage control handle to spread grease evenly.


- 3 Noise Adjustment Screws

If shunt block vibrates and becomes noisy, tighten adjustment screws 1/4 turn. Install wrapper, turn On unit, and check for shunt noise. Repeat procedure until noise stops. Do not overtighten. Call your nearest Factory Authorized Service Agent if noise continues.

▲ Install wrapper before turning On power.

802 248-C

## 6-3. Reinstalling Amperage Adjustment Indicator

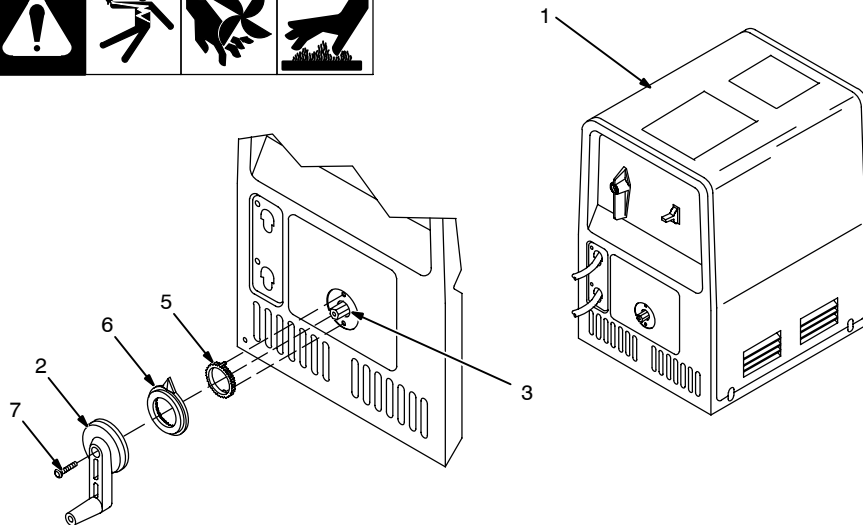

▲ **Turn Off welding power source and disconnect input power.**

1 Wrapper

Remove wrapper from unit.

2 Crank Handle

3 Shunt Shaft

4 Transformer And Shunt  
(Located Inside Unit)

Insert crank handle onto shunt shaft protruding through front panel and turn crank handle to adjust shunt to the proper value of "X", depending on model (see detail of transformer and shunt).

Remove crank handle.

5 Pinion Gear

Install pinion gear onto front panel making sure anti-rotation pins are in holes on front panel.

6 Pointer Gear




Install pointer gear overtop of pinion gear and rotate so pointer is indicating 130 Amps on ac Low Range scale (see example).

Install crank handle overtop the stator/pinion gear assembly with the handle straight down. It may be necessary to turn the handle slightly so vertical alignment is possible.

7 Securing Screw

Install securing screw through handle, into threaded hole in shunt shaft. Tighten securely.

Reinstall wrapper.

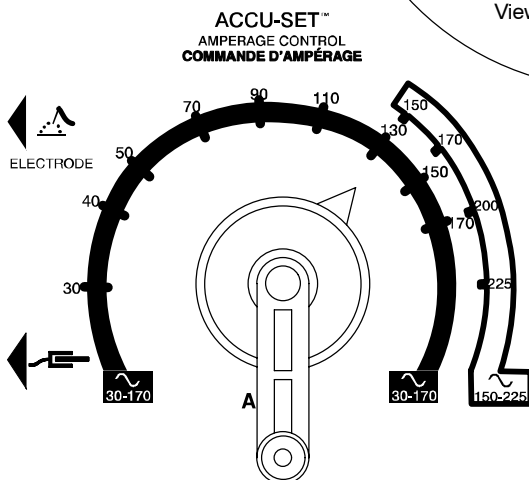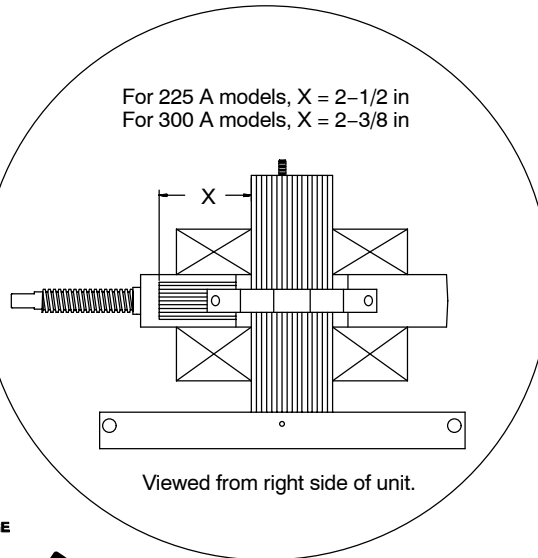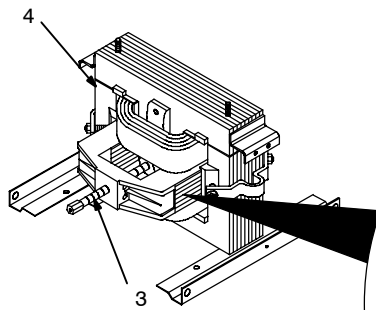

Proper alignment of pointer and crank handle.


Tools Needed:

T-20 Torx

5/16 in


Ref. 218 237-A / 802 248-C

## 6-4. Troubleshooting

 


Trouble		Remedy
No weld output; fan does not run.		Be sure line disconnect switch is in On position (see Section 4-10).
		Check and replace line fuses if open. Reset breakers if necessary (see Section 4-10).
Fan does not run; weld output okay.		Be sure nothing is blocking movement of fan. If fan does not run freely, replace fan motor.
Erratic weld current.		Clean and tighten all weld cable connections.
Erratic arc with excessive spatter.		Use dry, properly stored electrodes.
		Shorten arc length.
		Reduce amperage setting (see Section 5-1).
Electrode freezing to work.		Increase amperage setting (see Section 5-1).
		Increase arc length.
		Use dry, properly stored electrodes.
Noise and vibration from shunt block.		Lubricate shunt block and/or tighten adjustment screws (see Section 6-2).

## SECTION 7 – ELECTRICAL DIAGRAMS

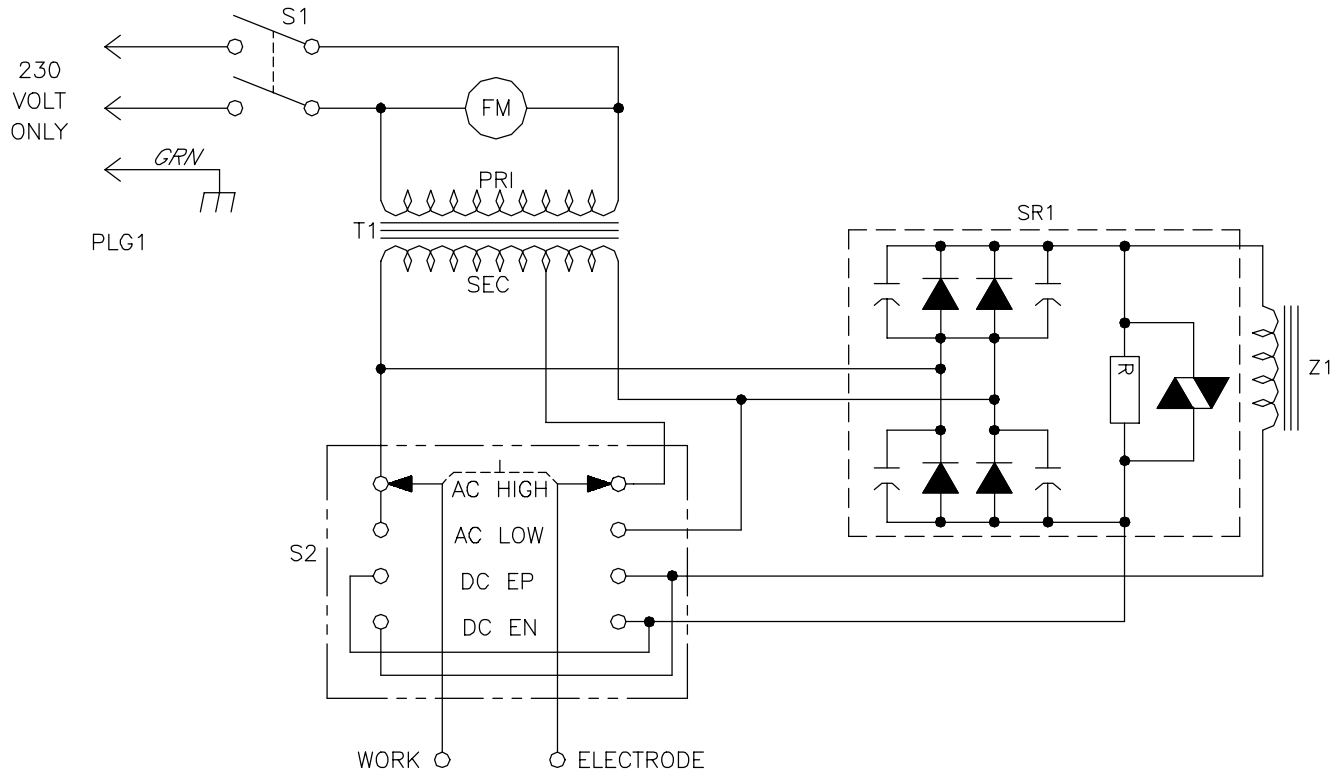


191 364

**Figure 7-1. Circuit Diagram For AC/DC (230 Volts) Models**

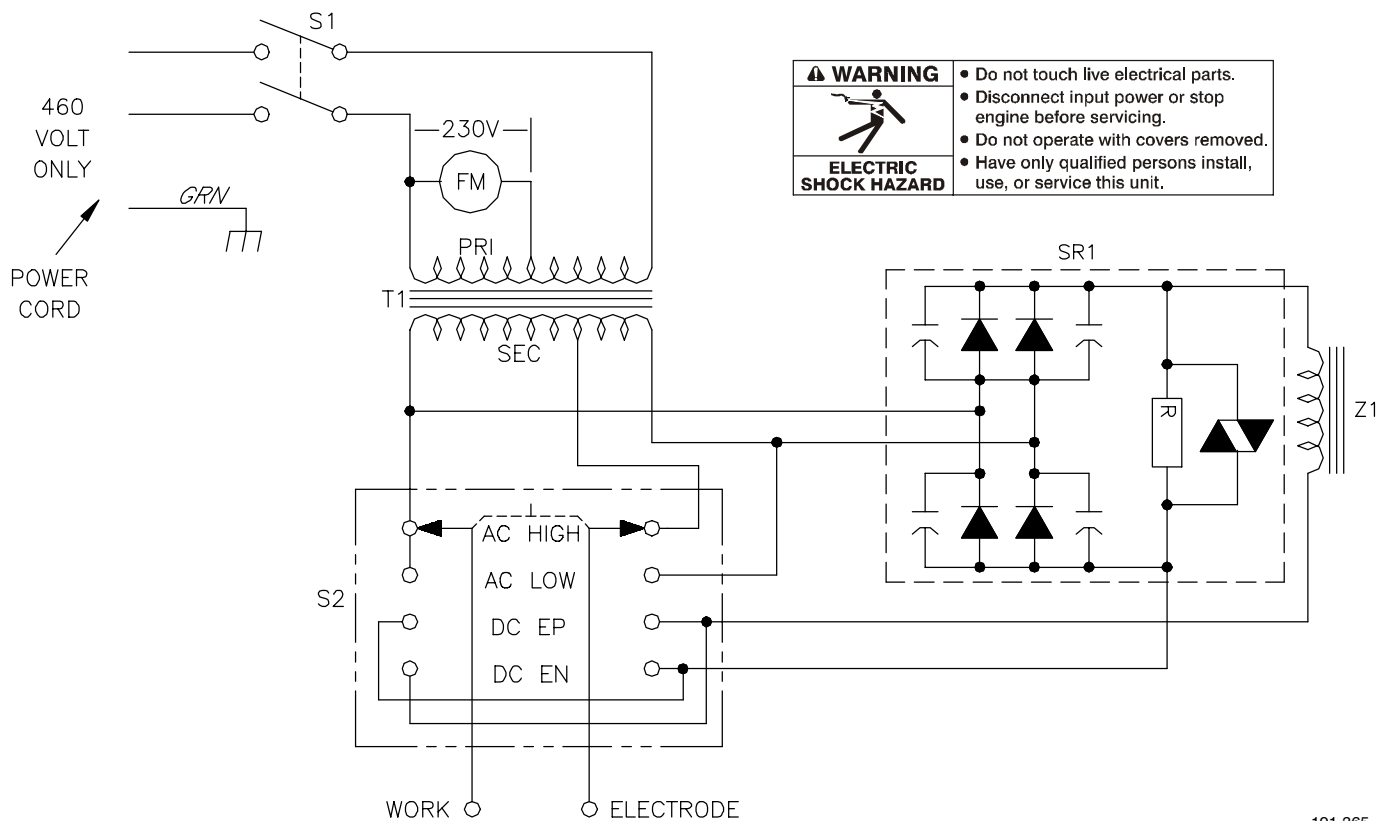


191 365


**Figure 7-2. Circuit Diagram For AC/DC (460 Volts) Models**

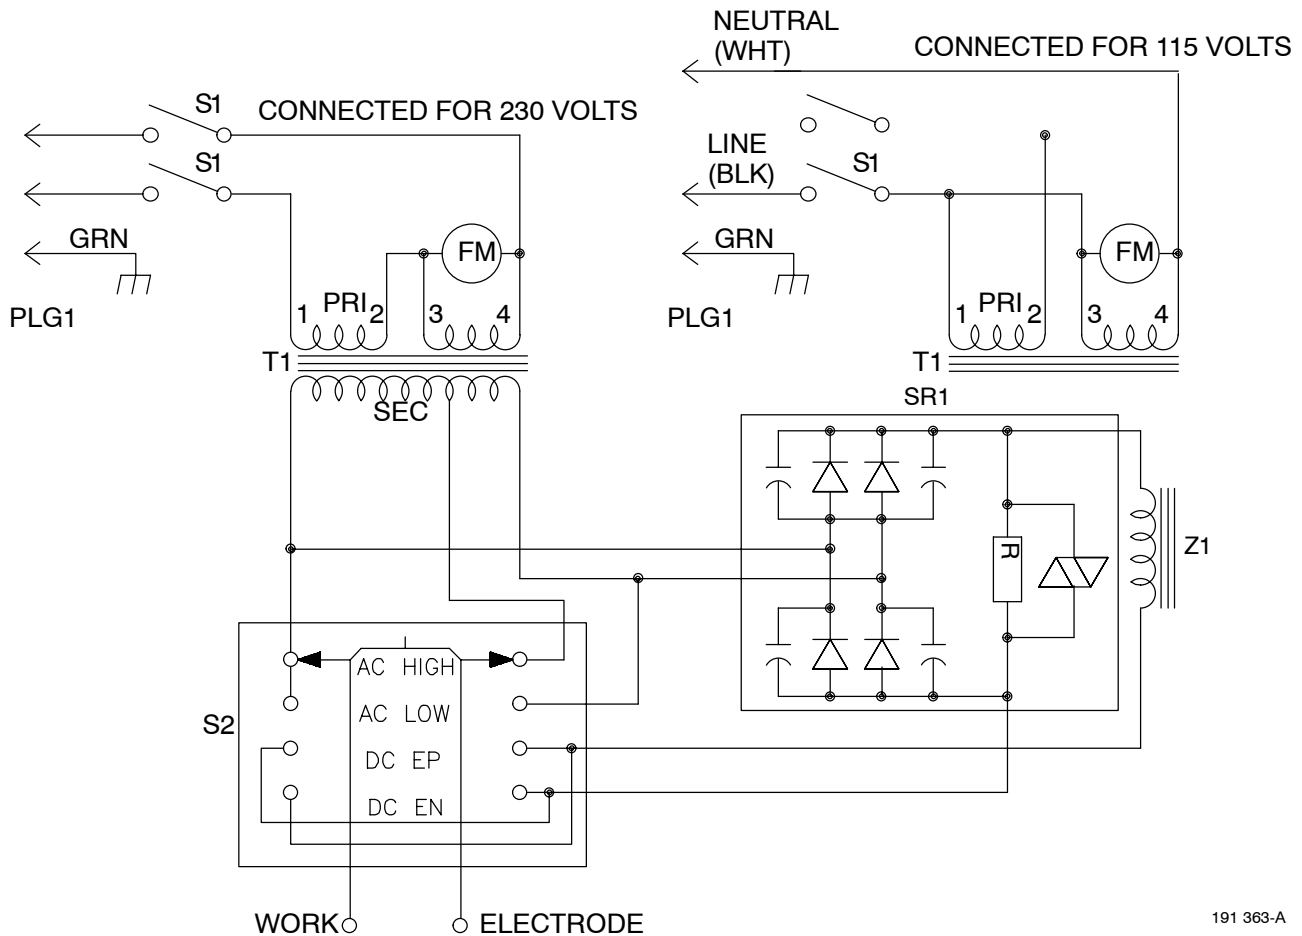

**Figure 7-3. Circuit Diagram For AC/DC (115/230 Volts) Models**

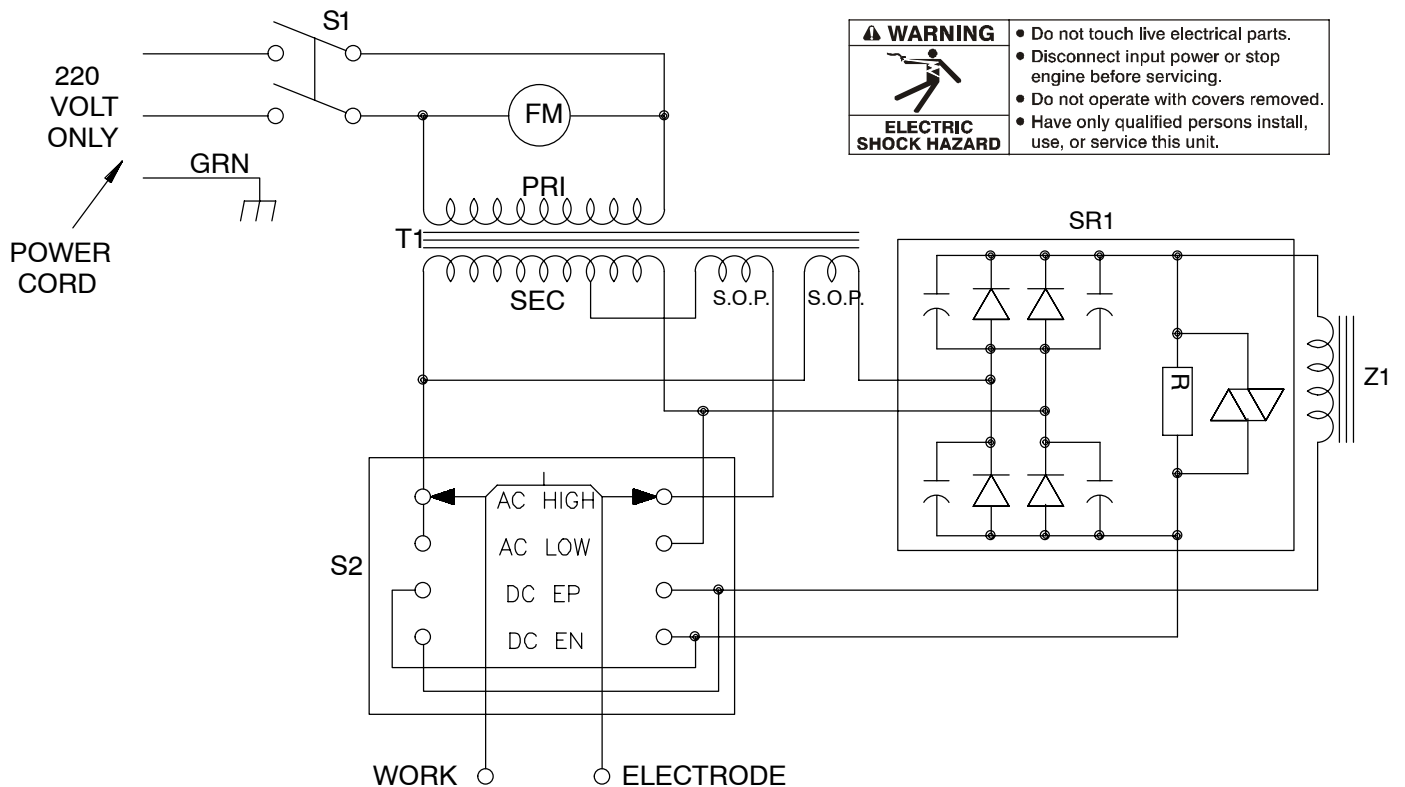


**Figure 7-4. Circuit Diagram For 300/200 AC/DC (220 Volts) Models**

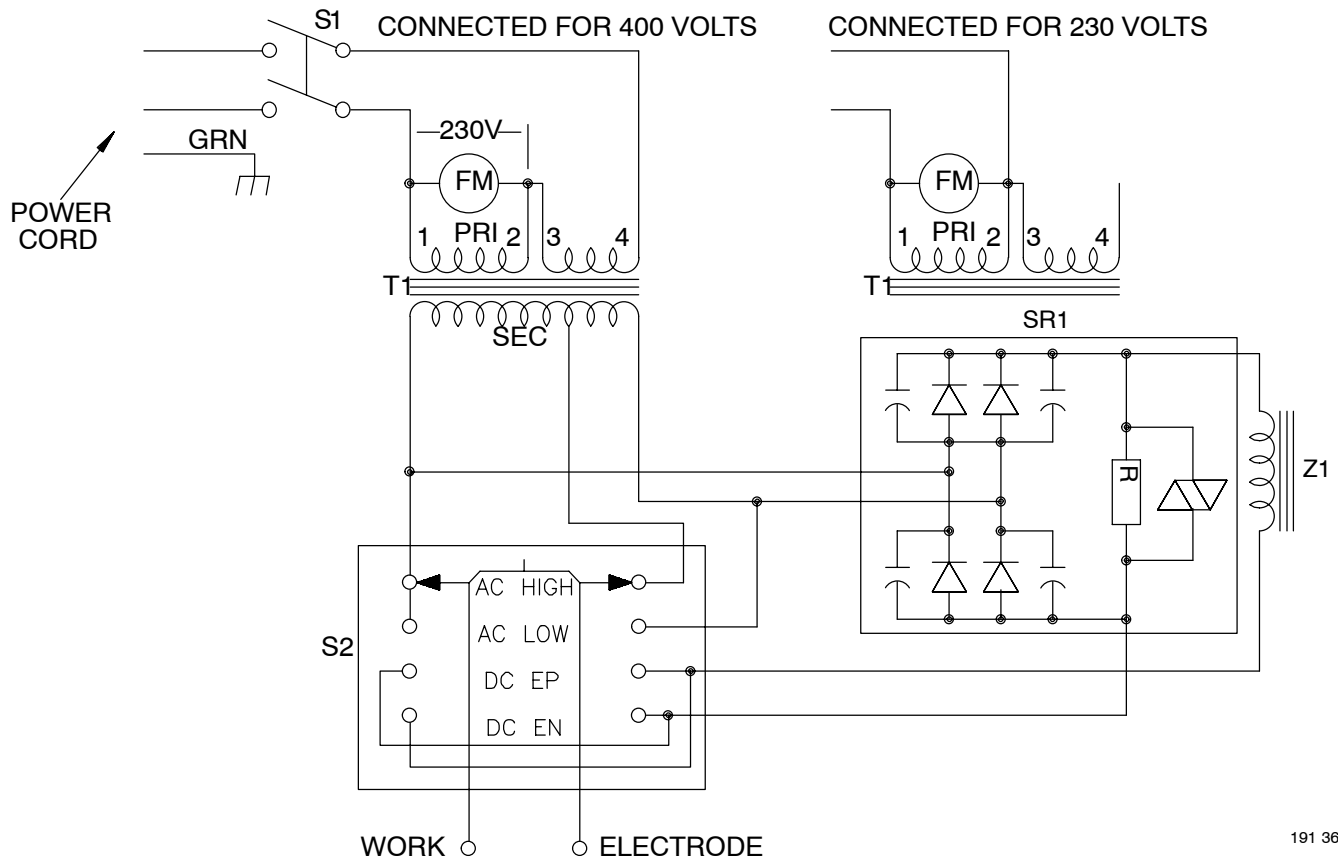


191 369

**Figure 7-5. Circuit Diagram For 300/200 AC/DC (230/400 Volts) Models**

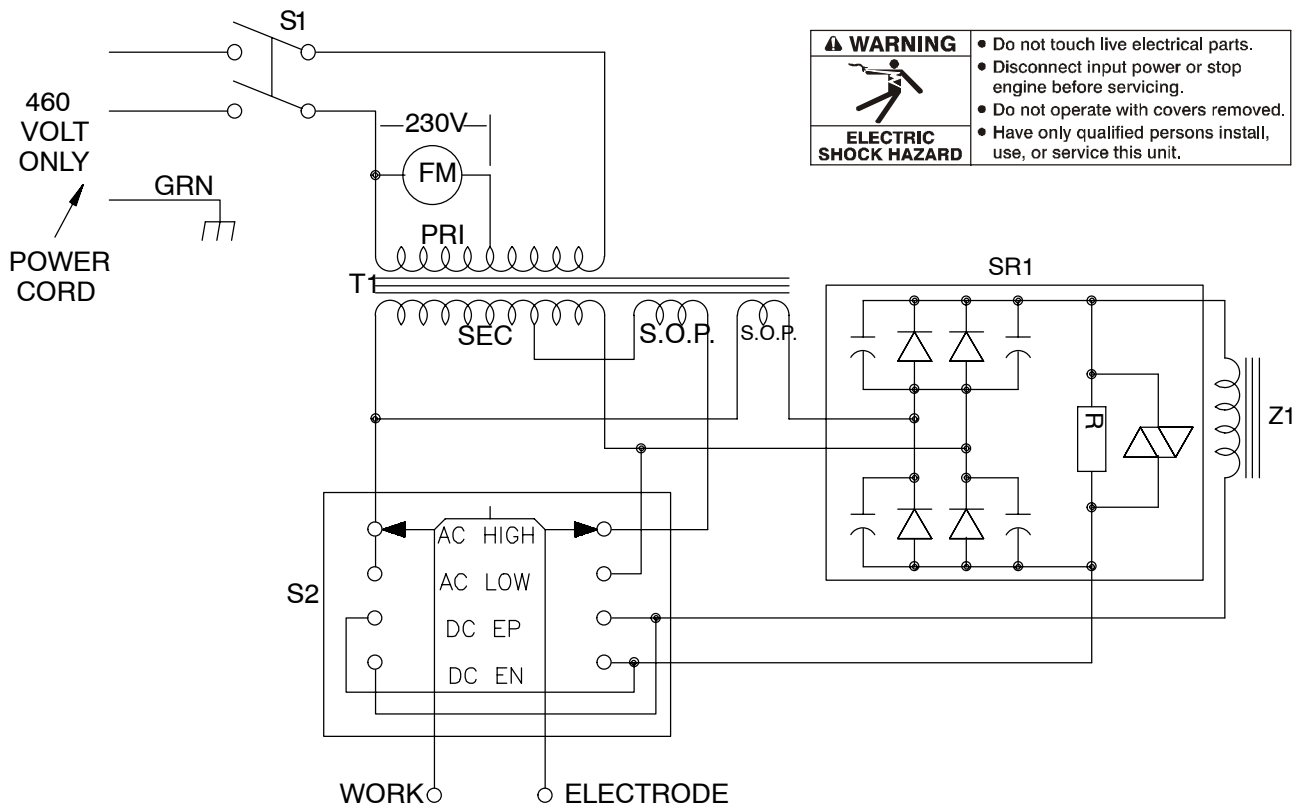


191 370

**Figure 7-6. Circuit Diagram For 300/200 AC/DC (460 Volts) Model**

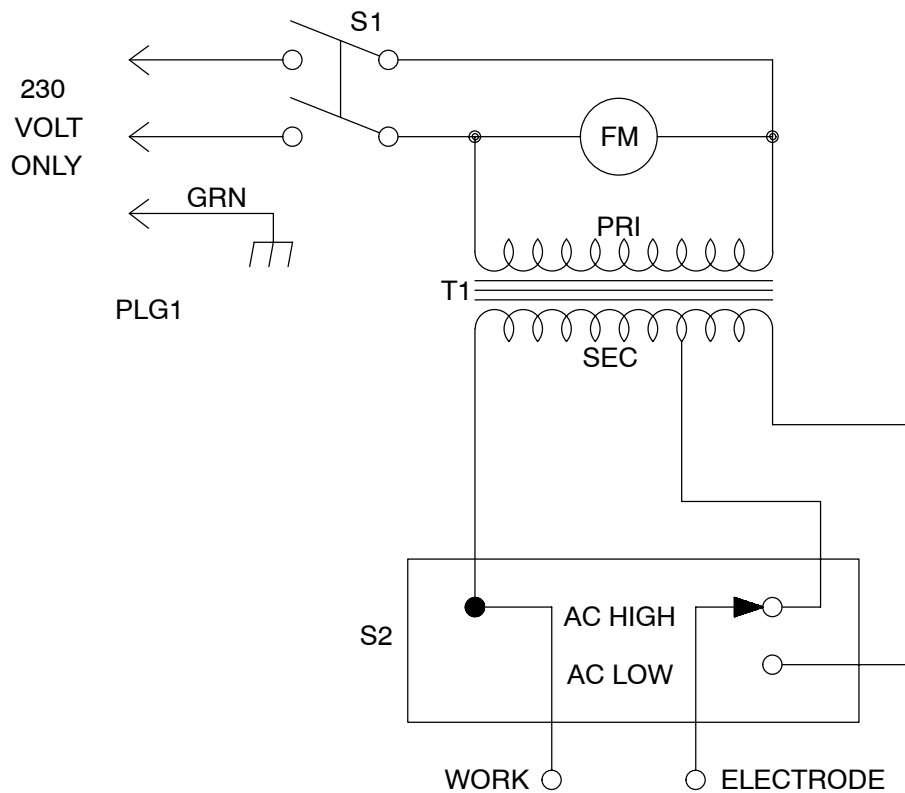

191 362


**Figure 7-7. Circuit Diagram For 225 (230 Volts) Models**

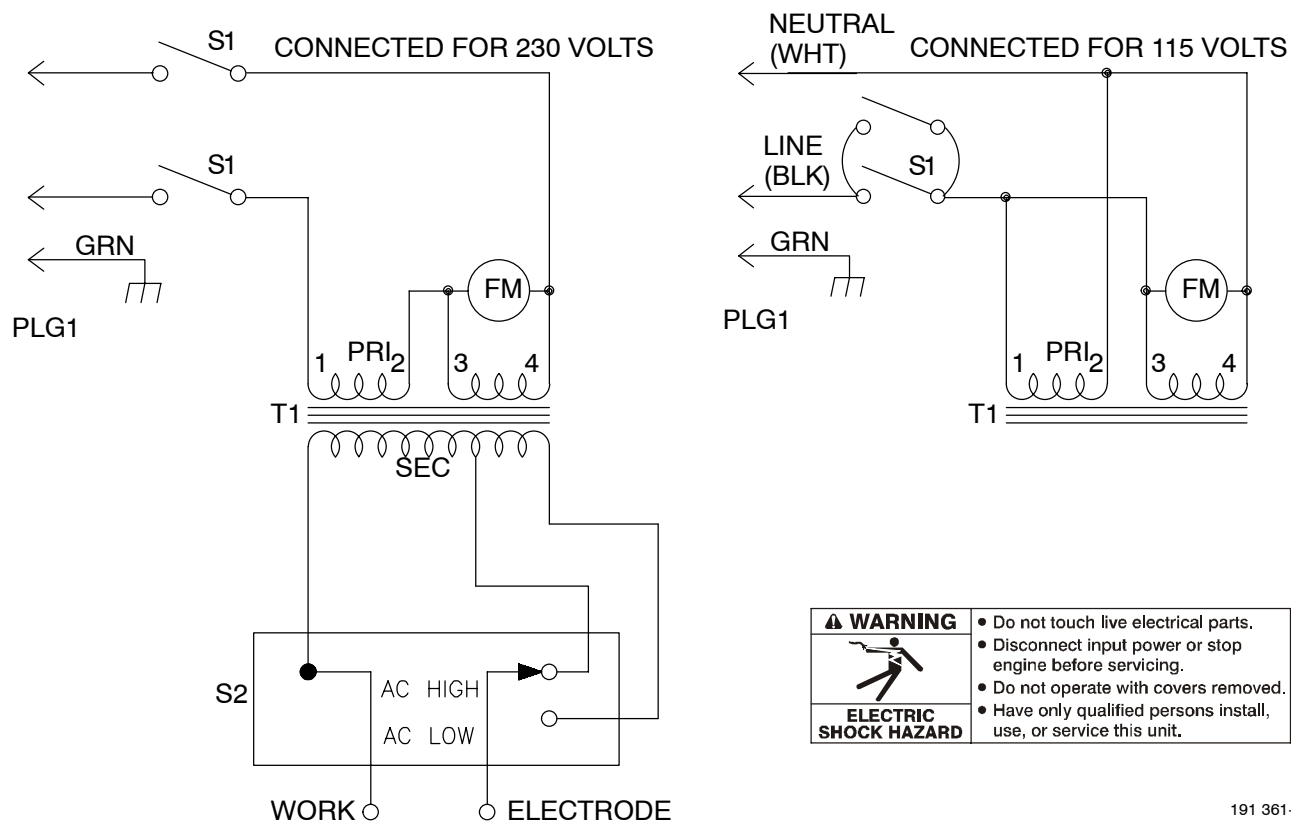

191 361-A


**Figure 7-8. Circuit Diagram For 225 (115/230 Volts) Models**



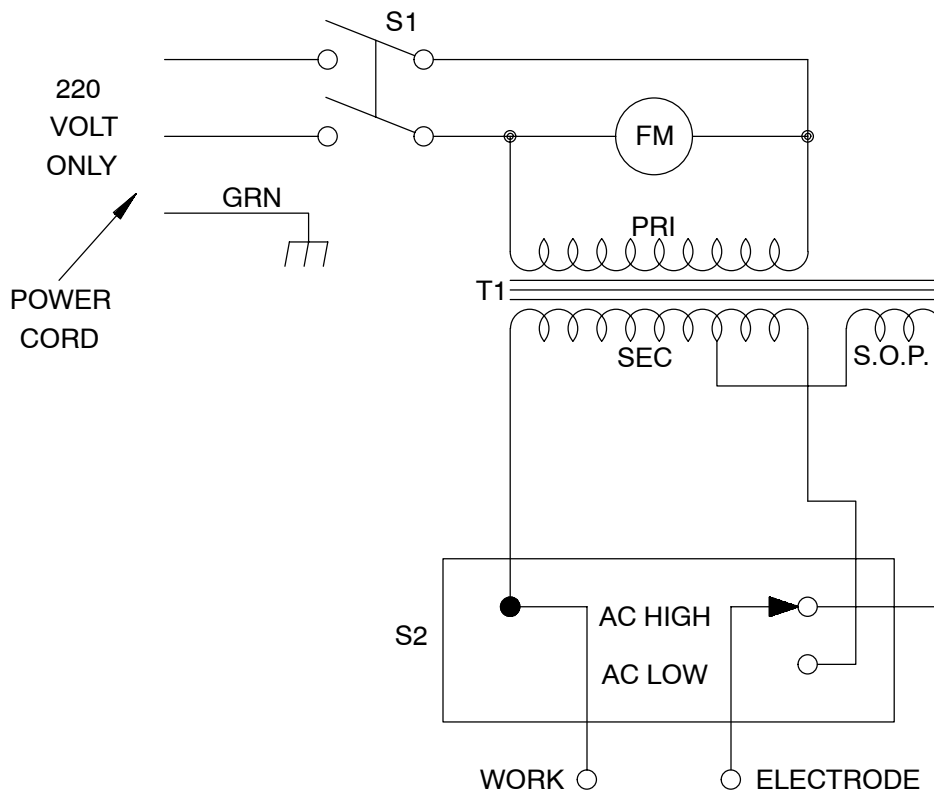

191 366

**Figure 7-9. Circuit Diagram For 300 (220 Volts) Models**

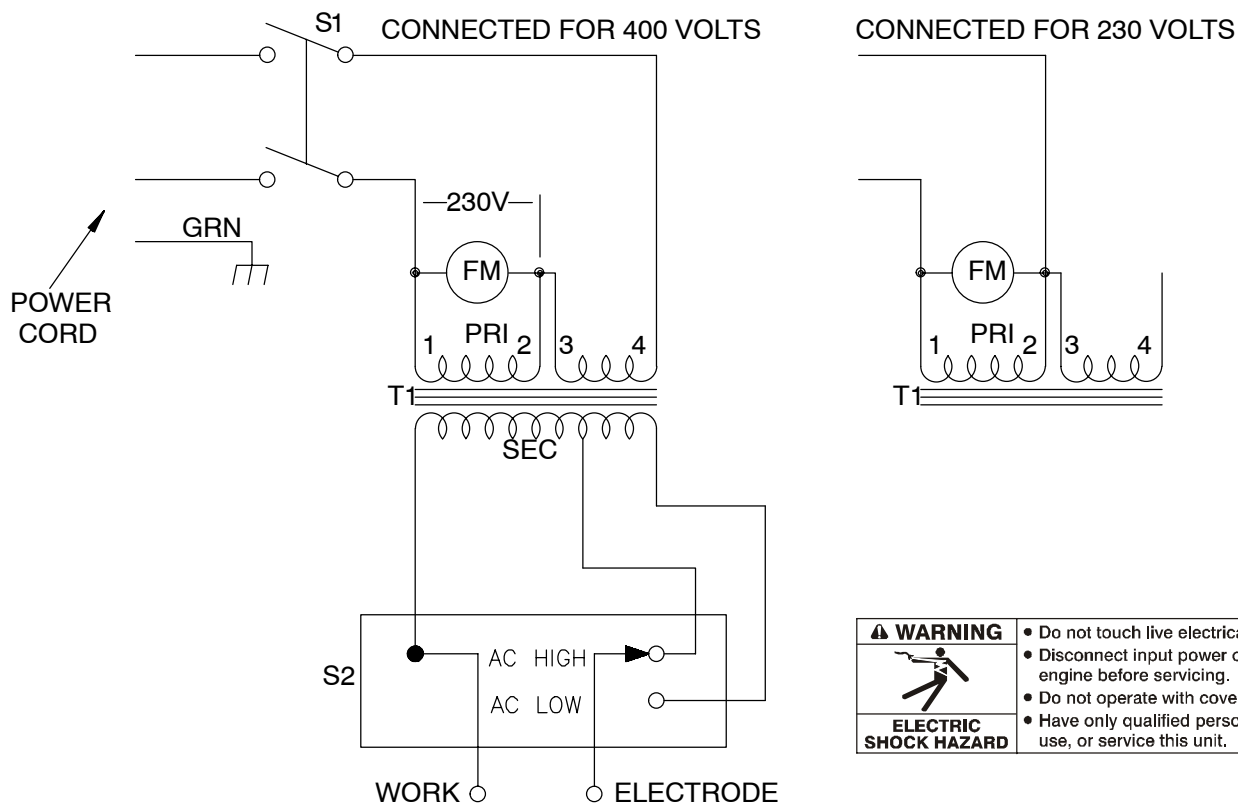

	<b>⚠ WARNING</b>
	<ul style="list-style-type: none"> <li>Do not touch live electrical parts.</li> <li>Disconnect input power or stop engine before servicing.</li> <li>Do not operate with covers removed.</li> <li>Have only qualified persons install, use, or service this unit.</li> </ul>
<b>ELECTRIC SHOCK HAZARD</b>	

191 367

**Figure 7-10. Circuit Diagram For 300 (230/400 Volts) Models**


# SECTION 8 – WELDING METHODS & TROUBLESHOOTING

mod5.1\* 9/92


## A. Welding Methods



### 8-1. Shielded Metal Arc Welding (SMAW) Procedure

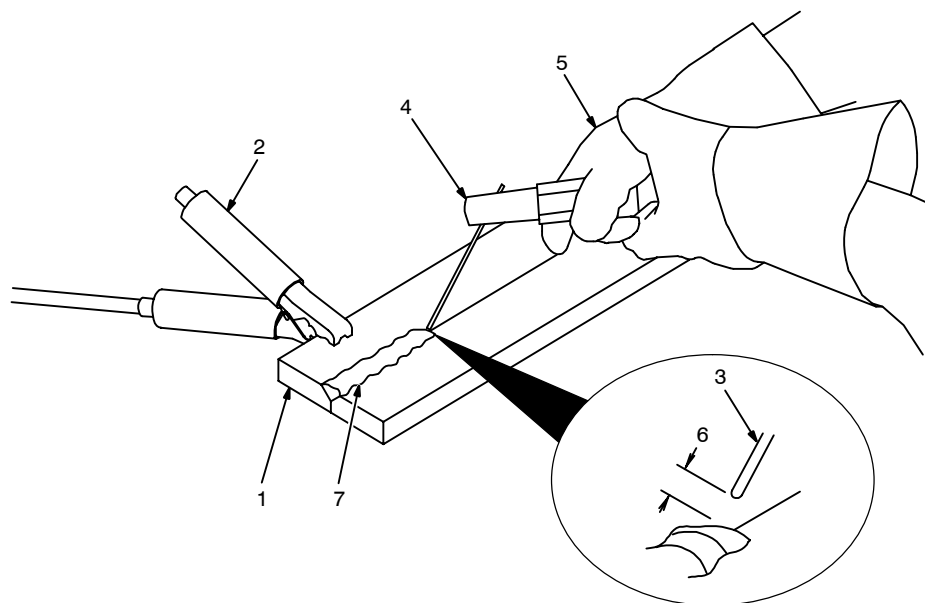

Tools Needed:

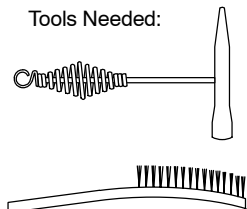

151 593

1 Workpiece

Make sure workpiece is clean before welding.

2 Work Clamp

Place as close to the weld as possible.

3 Electrode

A small diameter electrode requires less current than a large one. Follow recommendations of electrode manufacturer when setting weld amperage (see 8-2).

4 Insulated Electrode Holder

5 Electrode Holder Position

6 Arc Length

Arc length is the distance from the electrode to the workpiece. A short arc with correct amperage will give a sharp, crackling sound.

▲ **Welding current starts as soon as electrode touches the workpiece.**

7 Slag

Use a chipping hammer and wire brush to remove slag. Remove slag and check weld bead before making another weld pass.

## 8-2. Electrode And Amperage Selection Chart


ELECTRODE	DIAMETER	AMPERAGE RANGE								
		50	100	150	200	250	300	350	400	450
6010 & 6011	3/32									
	1/8									
	5/32									
	3/16									
	7/32									
6013	1/4									
	1/16									
	5/64									
	3/32									
	1/8									
7014	5/32									
	3/16									
	7/32									
	1/4									
	3/32									
7018	1/8									
	5/32									
	3/16									
	7/32									
	1/4									
7024	3/32									
	1/8									
	5/32									
	3/16									
	7/32									
Ni-CI	1/4									
	3/32									
	1/8									
	5/32									
	3/16									
308L	7/32									
	1/4									
	3/32									
308L	1/8									
	5/32									

ELECTRODE	DC*	AC	POSITION	PENETRATION	USAGE
6010	EP		ALL	DEEP	MIN. PREP, ROUGH HIGH SPATTER
6011	EP	✓	ALL	DEEP	
6013	EP,EN	✓	ALL	LOW	GENERAL
7014	EP,EN	✓	ALL	MED	SMOOTH, EASY, FAST
7018	EP	✓	ALL	LOW	LOW HYDROGEN, STRONG
7024	EP,EN	✓	FLAT HORIZ FILLET	LOW	SMOOTH, EASY, FASTER
NI-CL	EP	✓	ALL	LOW	CAST IRON
308L	EP	✓	ALL	LOW	STAINLESS

\*EP = ELECTRODE POSITIVE (REVERSE POLARITY)  
EN = ELECTRODE NEGATIVE (STRAIGHT POLARITY)

### 8-3. Striking An Arc


Scratch Start Technique

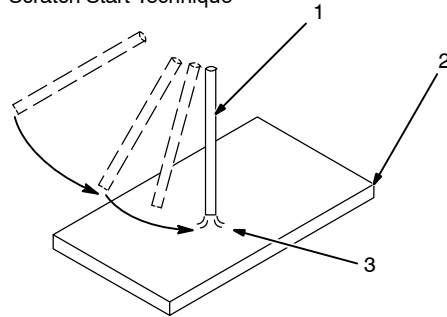

- 1 Electrode
- 2 Workpiece
- 3 Arc

Drag electrode across workpiece like striking a match; lift electrode slightly after touching work. If arc goes out electrode was lifted too high. If electrode sticks to workpiece, use a quick twist to free it.



Tap Start Technique

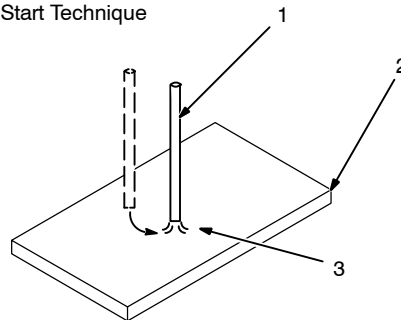



Bring electrode straight down to workpiece; then lift slightly to start arc. If arc goes out, electrode was lifted too high. If electrode sticks to workpiece, use a quick twist to free it.

S-0049 / S-0050

### 8-4. Positioning The Electrode Holder

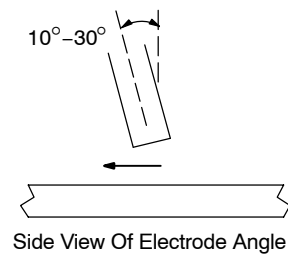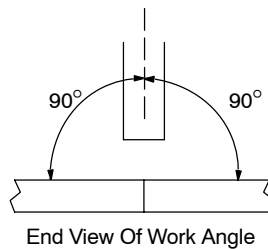

Groove Welds

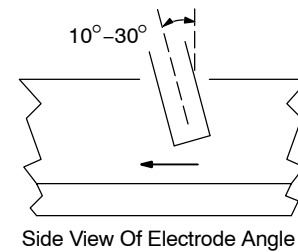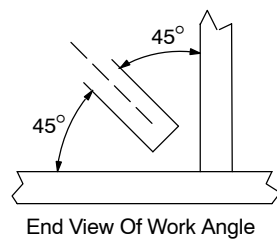


Fillet Welds

S-0660

## 8-5. Weld Bead Characteristics


Poor Weld Bead

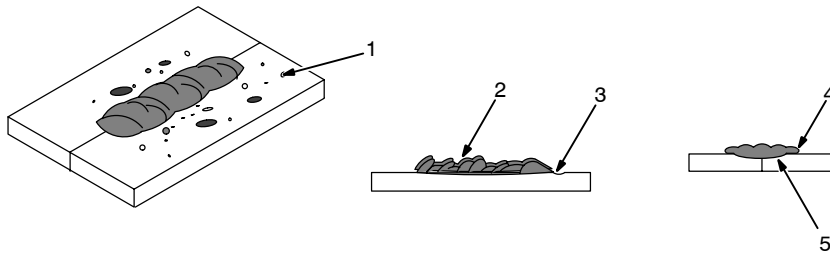

- 1 Large Spatter Deposits
- 2 Rough, Uneven Bead
- 3 Slight Crater During Welding
- 4 Bad Overlap
- 5 Poor Penetration

S-0053-A

Good Weld Bead

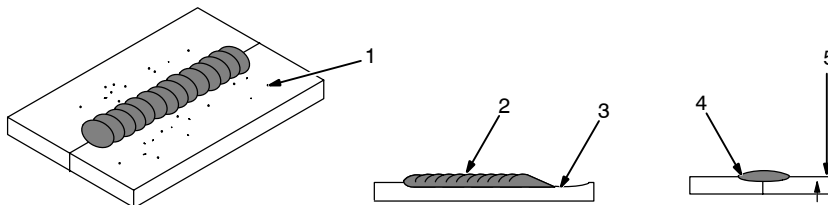


- 1 Fine Spatter
  - 2 Uniform Bead
  - 3 Moderate Crater During Welding
- Weld a new bead or layer for each 1/8 in (3.2 mm) thickness in metals being welded.
- 4 No Overlap
  - 5 Good Penetration Into Base Metal


Ref. S-0052-B

## 8-6. Conditions That Affect Weld Bead Shape


### Electrode Angle

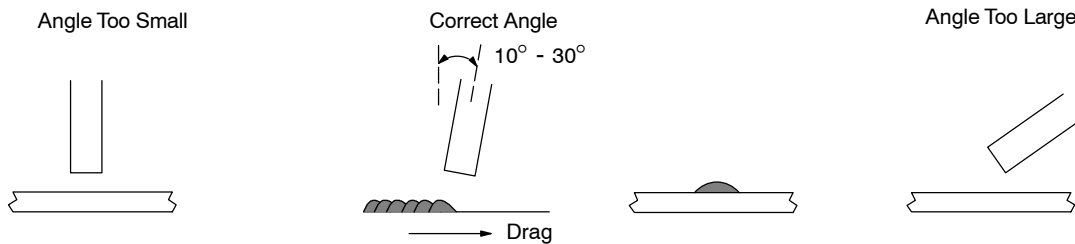

### Arc Length



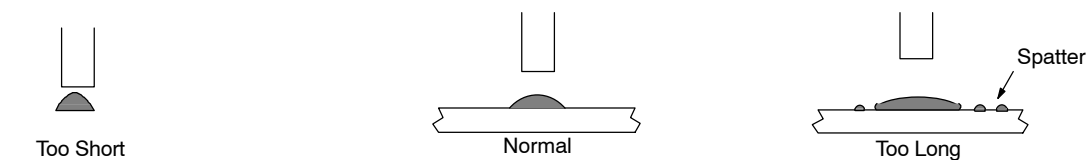


### Travel Speed

 


S-0061

## 8-7. Electrode Movement During Welding

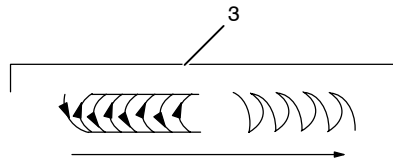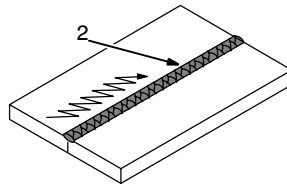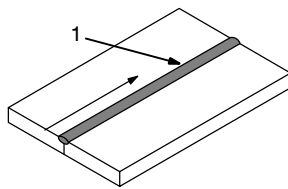






- 1 Stringer Bead – Steady Movement Along Seam
- 2 Weave Bead – Side To Side Movement Along Seam
- 3 Weave Patterns

 Use weave patterns to cover a wide area in one pass of the electrode. Do not let weave width exceed 2-1/2 times diameter of electrode.

 A single stringer bead is satisfactory for most narrow groove weld joints. For wide groove weld joints or bridging across gaps, a weave bead works better.

S-0054-A

## 8-8. Butt Joints

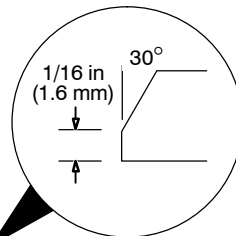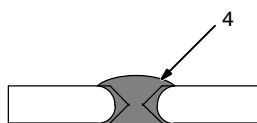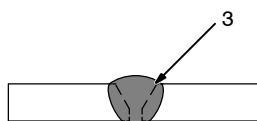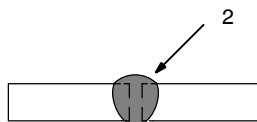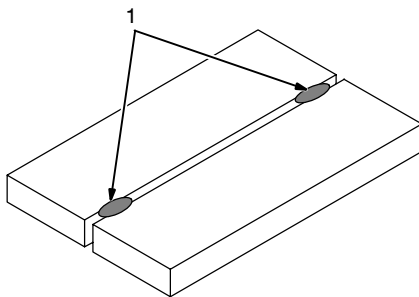

- 1 Tack Welds

Prevent edges of joint from drawing together ahead of electrode by tack welding the materials in position before final weld.

- 2 Square Groove Weld

Good for materials up to 3/16 in (5 mm) thick.

- 3 Single V-Groove Weld

Good for materials 3/16 through 3/4 in (5-19 mm) thick. Cut bevel with oxyacetylene or plasma cutting equipment. Remove scale from material after cutting. A grinder can also be used to prepare bevels.


Create 30 degree angle of bevel on materials in V-groove welding.

- 4 Double V-Groove Weld

Good for materials thicker than 3/16 in (5 mm).

S-0662


## 8-9. Lap Joints

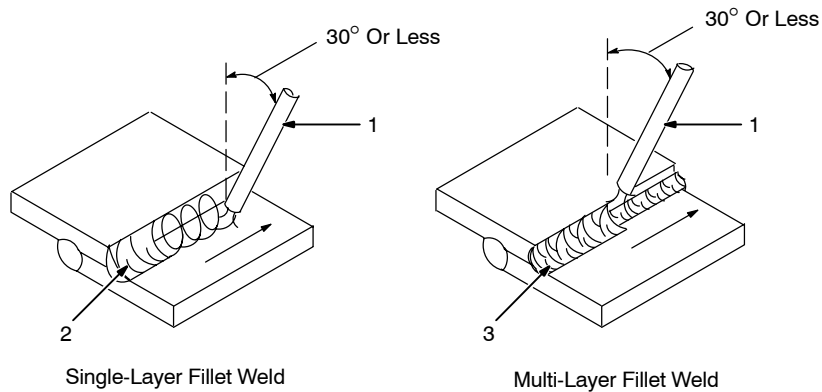

- 1 Electrode
- 2 Single-Layer Fillet Weld  
Move electrode in circular motion.
- 3 Multi-Layer Fillet Weld  
Weld a second layer when a larger fillet is needed. Remove slag before making another weld pass. Weld both sides of joint for maximum strength.

S-0063 / S-0064

## 8-10. Tee Joints

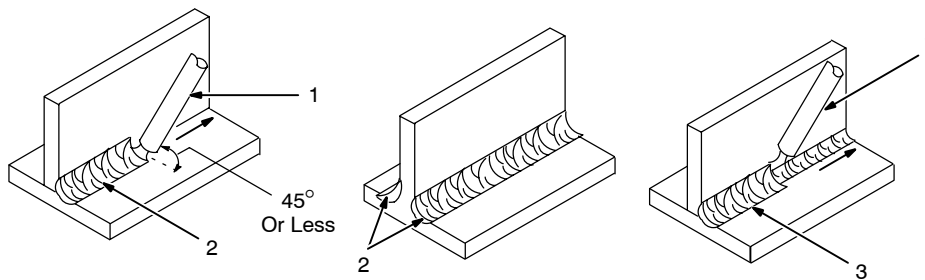


- 1 Electrode
- 2 Fillet Weld  
Keep arc short and move at definite rate of speed. Hold electrode as shown to provide fusion into the corner. Square edge of the weld surface.  
For maximum strength weld both sides of upright section.
- 3 Multi-Layer Deposits  
Weld a second layer or more when a larger fillet is needed. Use any of the weaving patterns shown in Section 8-7. Remove slag before making another weld pass.

S-0069 / S-0058-A / S-0061


## B. Welding Troubleshooting




**Table 6-1. Porosity**

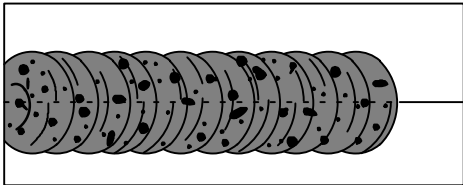		Porosity – small cavities or holes resulting from gas pockets in weld metal.
Possible Causes	Corrective Actions	
Arc length too long.	Reduce arc length.	
Damp electrode.	Use dry electrode.	
Workpiece dirty.	Remove all grease, oil, moisture, rust, paint, coatings, slag, and dirt from work surface before welding.	


**Table 6-2. Excessive Spatter**

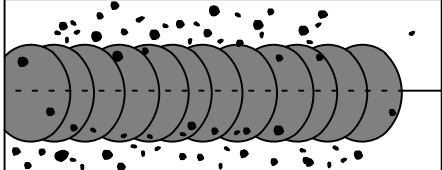 <p>Excessive Spatter – scattering of molten metal particles that cool to solid form near weld bead.</p>	
Possible Causes	Corrective Actions
Amperage too high for electrode.	Decrease amperage or select larger electrode.
Arc length too long or voltage too high	Reduce arc length or voltage.

**Table 6-3. Incomplete Fusion**


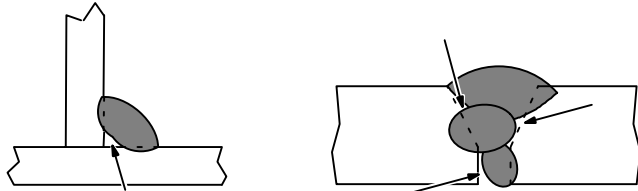
 <p>Incomplete Fusion – failure of weld metal to fuse completely with base metal or a preceding weld bead.</p>	
Possible Causes	Corrective Actions
Insufficient heat input.	Increase amperage. Select larger electrode and increase amperage.
Improper welding technique.	Place stringer bead in proper location(s) at joint during welding. Adjust work angle or widen groove to access bottom during welding. Momentarily hold arc on groove side walls when using weaving technique. Keep arc on leading edge of weld puddle.
Workpiece dirty.	Remove all grease, oil, moisture, rust, paint, coatings, slag, and dirt from work surface before welding.

**Table 6-4. Lack Of Penetration**

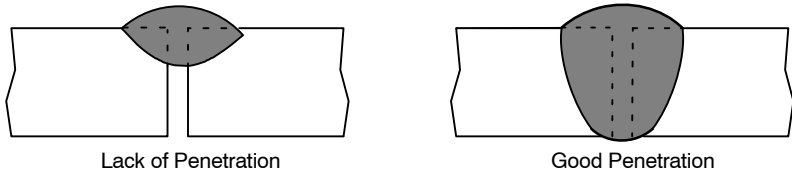
 <p>Lack of Penetration</p> <p>Good Penetration</p> <p>Lack Of Penetration – shallow fusion between weld metal and base metal.</p>	
Possible Causes	Corrective Actions
Improper joint preparation.	Material too thick. Joint preparation and design must provide access to bottom of groove.
Improper weld technique.	Keep arc on leading edge of weld puddle.
Insufficient heat input.	Increase amperage. Select larger electrode and increase amperage. Reduce travel speed.




**Table 6-5. Excessive Penetration**
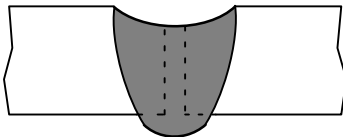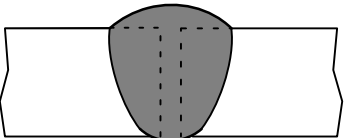
<div style="display: flex; justify-content: space-around; align-items: center;">   </div> <div style="display: flex; justify-content: space-around; margin-top: 5px;"> <p>Excessive Penetration</p> <p>Good Penetration</p> </div>		Excessive Penetration – weld metal melting through base metal and hanging underneath weld.
Possible Causes	Corrective Actions	
Excessive heat input.	Select lower amperage. Use smaller electrode. Increase and/or maintain steady travel speed.	


**Table 6-6. Burn-Through**

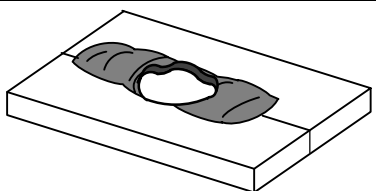		Burn-Through – weld metal melting completely through base metal resulting in holes where no metal remains.
Possible Causes	Corrective Actions	
Excessive heat input.	Select lower amperage. Use smaller electrode with lower amperage. Increase and/or maintain steady travel speed.	


**Table 6-7. Waviness Of Bead**

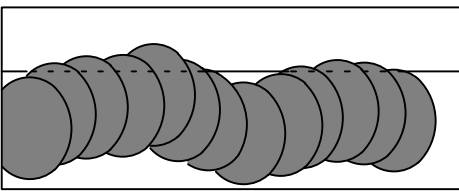		Waviness Of Bead – weld metal that is not parallel and does not cover joint formed by base metal.
Possible Causes	Corrective Actions	
Unsteady hand.	Use two hands. Practice technique.	

**Table 6-8. Distortion**

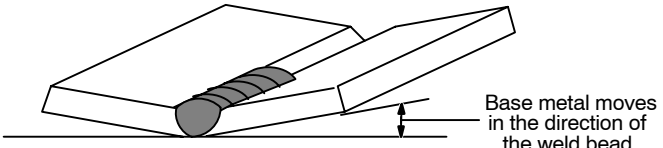		Distortion – contraction of weld metal during welding that forces base metal to move.
Possible Causes	Corrective Actions	
Excessive heat input.	Use restraint (clamp) to hold base metal in position. Make tack welds along joint before starting welding operation. Select lower amperage for electrode. Increase travel speed. Weld in small segments and allow cooling between welds.	

# SECTION 9 – PARTS LIST

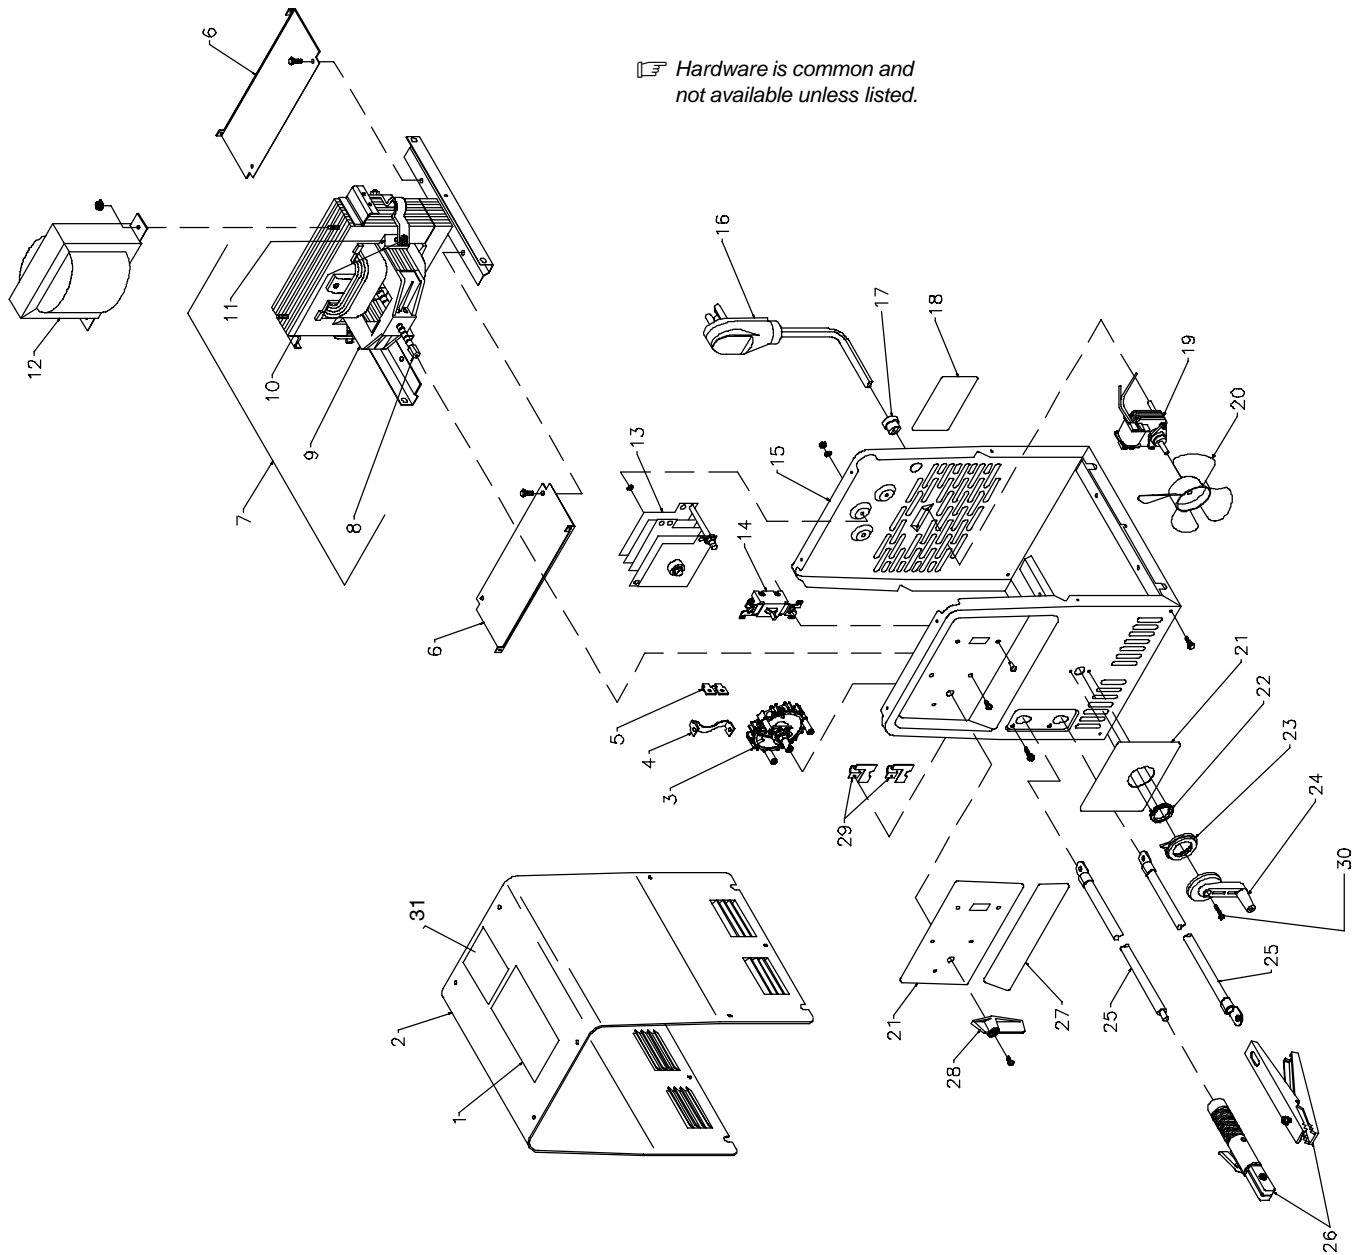

802 245-E

**Figure 9-1. Main Assembly (AC/DC model illustrated)**

Item No.	Dia. Mkgs.	Part No.	Description	Quantity
<b>Figure 9-1. Main Assembly</b>				
.. 1		134 464	.. LABEL, warning general precautionary static&wire fe	1
.. 1		217 732	.. LABEL, warning general precautionary (EN/FR) vert	1
.. 2		210 309	.. +WRAPPER	1
.. 3	S2	190 079	.. SWITCH, secondary 2-position (AC 225 model) & (AC 300 model)	1
.. 3	S2	190 080	.. SWITCH, secondary 4-position (AC/DC 225 model) & (AC/DC 300 model)	1
.. 4		190 977	.. BUS BAR, jumper (AC/DC 225 model) & (AC/DC 300 model)	2
.. 5		190 978	.. BUS BAR, jumper (AC/DC 225 model) & (AC/DC 300 model)	1
.. 6		191 122	.. BRACKET, base reinforcing	2
.. 7	T1	190 170	.. TRANSFORMER & SHUNT, (230V 225A model) (consisting of)	1
.. 7	T1	192 467	.. TRANSFORMER & SHUNT, (460V 225A model) (consisting of)	1
.. 7	T1	192 468	.. TRANSFORMER & SHUNT, (115/230V 225A model) (consisting of)	1
.. 7	T1	192 179	.. TRANSFORMER & SHUNT, (220V 300A AC/DC model) (consisting of)	1
.. 7	T1	192 317	.. TRANSFORMER & SHUNT, (220V 300A AC model) (consisting of)	1
.. 7	T1	192 326	.. TRANSFORMER & SHUNT, (230/400V 300A model) (consisting of)	1
.. 7	T1	192 469	.. TRANSFORMER & SHUNT, (460V 300A model) (consisting of)	1
.. 8		190 242	.. SCREW, lead shunt	1
.. 9		190 150	.. SHUNT	1
.. 10		147 907	.. SCREW, 5/16-18 x 1.75 w/loctite	4
.. 11		080 522	.. BLOCK, anti-noise shunt	4
.. 12	Z1	190 145	.. STABILIZER, (AC/DC 225A model)	1
.. 12	Z1	192 177	.. STABILIZER, (AC/DC 300A model)	1
.. 13	SR1	190 303	.. RECTIFIER, (AC/DC 225A model)	1
.. 13	SR1	190 965	.. RECTIFIER, (AC/DC 300A model)	1
.. 14	S1	124 511	.. SWITCH, (all 225A models)	1
.. 14	S1	045 834	.. SWITCH, (all 300A models)	1
.. 15		190 086	.. CASE SECTION	1
.. 16	PLG1	088 297	.. CORD SET (230V 225A model)	1
.. 16		071 906	.. CABLE (460V 225A model) & (115/230V 225A model)	1
.. 16		204 141	.. CABLE (all 300A models)	1
.. 17		111 443	.. BUSHING, strain relief (230V 225A model)	1
.. 17		604 102	.. CONNECTOR (all 300A models), (460V 225A model) & (115/230V model)	1
.. 18		185 759	.. LABEL, warning electric shock & input power	1
.. 18		217 733	.. LABEL, warning electric shock & input power (EN/FR)	1
.. 19	FM	190 234	.. MOTOR, fan (all models except 115/230V)	1
.. 19	FM	191 864	.. MOTOR, fan (115/230V models)	1
.. 20		005 656	.. BLADE, fan	1
.. 21		190 599	.. LABEL, control/output ac 225 amp	1
.. 21		190 600	.. LABEL, control/output ac/dc 225/150 amp	1
.. 21		192 119	.. LABEL, control/output ac 300 amp	1
.. 21		192 120	.. LABEL, control/output ac/dc 300/200 amp	1
.. 21		218 237	.. LABEL, control/output ac 225 amp (EN/FR)	1
.. 21		217 857	.. LABEL, control/output ac/dc 225/150 amp (EN/FR)	1
.. 22		190 296	.. GEAR, pinion	1
.. 23		190 295	.. GEAR, pointer	1
.. 24		190 241	.. HANDLE, control current	1
.. 25		190 538	.. LEAD LIST	1
.. 26		190 584	.. KIT, electrode holder & gnd clamp	1
.. 27		191 635	.. LABEL, brand identity Thunderbolt XL	1
.. 27		217 964	.. LABEL, brand identity Thunderbolt XL (EN/FR)	1
.. 28		207 074	.. HANDLE, switch	1
.. 29		190 243	.. CLAMP, weld cable	2
.. 30		494 907	.. SCREW, K50 x 20 pan hd-trx stl pld thread forming	1
.. 31		216 361	.. LABEL, electrode/amperage selector (not included w/EN/FR models)	1


+When ordering a component originally displaying a precautionary label, the label should also be ordered.

Note: "225A model" and "300A model" refers to the AC output rating of the AC/DC and the AC only machines.

**To maintain the factory original performance of your equipment, use only Manufacturer's Suggested Replacement Parts. Model and serial number required when ordering parts from your local distributor.**

## Notes

# Notes

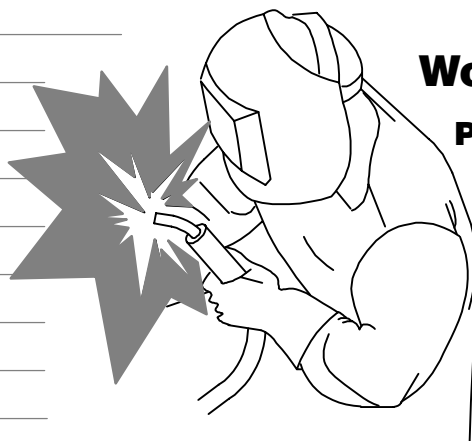

**Work like a Pro!**

**Pros weld and cut safely. Read the safety rules at the beginning of this manual.**

# Notes

## DECIMAL EQUIVALENTS

	$\frac{1}{64}$	.015625
$\frac{1}{32}$	$\frac{3}{64}$	.03125
	$\frac{5}{64}$	.046875
$\frac{1}{16}$	$\frac{7}{64}$	.0625
	$\frac{9}{64}$	.078125
$\frac{3}{32}$	$\frac{11}{64}$	.09375
	$\frac{13}{64}$	.109375
$\frac{1}{8}$	$\frac{15}{64}$	.125
	$\frac{17}{64}$	.140625
$\frac{5}{32}$	$\frac{19}{64}$	.15625
	$\frac{21}{64}$	.171875
$\frac{3}{16}$	$\frac{23}{64}$	.1875
	$\frac{25}{64}$	.203125
$\frac{7}{32}$	$\frac{27}{64}$	.21875
	$\frac{29}{64}$	.234375
$\frac{1}{4}$	$\frac{31}{64}$	.25
	$\frac{33}{64}$	.265625
$\frac{9}{32}$	$\frac{35}{64}$	.28125
	$\frac{37}{64}$	.296875
$\frac{5}{16}$	$\frac{39}{64}$	.3125
	$\frac{41}{64}$	.328125
$\frac{11}{32}$	$\frac{43}{64}$	.34375
	$\frac{45}{64}$	.359375
$\frac{3}{8}$	$\frac{47}{64}$	.375
	$\frac{49}{64}$	.390625
$\frac{13}{32}$	$\frac{51}{64}$	.40625
	$\frac{53}{64}$	.421875
$\frac{7}{16}$	$\frac{55}{64}$	.4375
	$\frac{57}{64}$	.453125
$\frac{15}{32}$	$\frac{59}{64}$	.46875
	$\frac{61}{64}$	.484375
$\frac{1}{2}$	$\frac{63}{64}$	.5
		.515625
$\frac{17}{32}$		.53125
		.546875
$\frac{9}{16}$		.5625
		.578125
$\frac{19}{32}$		.59375
		.609375
$\frac{5}{8}$		.625
		.640625
$\frac{21}{32}$		.65625
		.671875
$\frac{11}{16}$		.6875
		.703125
$\frac{23}{32}$		.71875
		.734375
$\frac{3}{4}$		.75
		.765625
$\frac{25}{32}$		.78125
		.796875
$\frac{13}{16}$		.8125
		.828125
$\frac{27}{32}$		.84375
		.859375
$\frac{7}{8}$		.875
		.890625
$\frac{29}{32}$		.90625
		.921875
$\frac{15}{16}$		.9375
		.953125
$\frac{31}{32}$		.96875
		.984375
1		1.

# TRUE BLUE® WARRANTY

Effective January 1, 2004  
(Equipment with a serial number preface of "LE" or newer)

This limited warranty supersedes all previous Miller warranties and is exclusive with no other guarantees or warranties expressed or implied.

## Warranty Questions?

Call  
1-800-4-A-MILLER  
for your local  
Miller distributor.

Your distributor also gives  
you ...

### Service

You always get the fast,  
reliable response you  
need. Most replacement  
parts can be in your  
hands in 24 hours.

### Support

Need fast answers to the  
tough welding questions?  
Contact your distributor.  
The expertise of the  
distributor and Miller is  
there to help you, every  
step of the way.

**LIMITED WARRANTY** – Subject to the terms and conditions below, Miller Electric Mfg. Co., Appleton, Wisconsin, warrants to its original retail purchaser that new Miller equipment sold after the effective date of this limited warranty is free of defects in material and workmanship at the time it is shipped by Miller. THIS WARRANTY IS EXPRESSLY IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING THE WARRANTIES OF MERCHANTABILITY AND FITNESS.

Within the warranty periods listed below, Miller will repair or replace any warranted parts or components that fail due to such defects in material or workmanship. Miller must be notified in writing within thirty (30) days of such defect or failure, at which time Miller will provide instructions on the warranty claim procedures to be followed.

Miller shall honor warranty claims on warranted equipment listed below in the event of such a failure within the warranty time periods. All warranty time periods start on the date that the equipment was delivered to the original retail purchaser, or one year after the equipment is sent to a North American distributor or eighteen months after the equipment is sent to an International distributor.

1. 5 Years Parts — 3 Years Labor
  - \* Original main power rectifiers
  - \* Inverters (input and output rectifiers only)
2. 3 Years — Parts and Labor
  - \* Transformer/Rectifier Power Sources
  - \* Plasma Arc Cutting Power Sources
  - \* Semi-Automatic and Automatic Wire Feeders
  - \* Inverter Power Sources (Unless Otherwise Stated)
  - \* Water Coolant Systems (Integrated)
  - \* Intellitig
  - \* Maxstar 150
  - \* Engine Driven Welding Generators  
(NOTE: Engines are warranted separately by the engine manufacturer.)
3. 1 Year — Parts and Labor Unless Specified
  - \* DS-2 Wire Feeder
  - \* Motor Driven Guns (w/exception of Spoolmate Spoolguns)
  - \* Process Controllers
  - \* Positioners and Controllers
  - \* Automatic Motion Devices
  - \* RFCS Foot Controls
  - \* Induction Heating Power Sources and Coolers
  - \* Water Coolant Systems (Non-Integrated)
  - \* Flowgauge and Flowmeter Regulators (No Labor)
  - \* HF Units
  - \* Grids
  - \* Maxstar 85, 140
  - \* Spot Welders
  - \* Load Banks
  - \* Arc Stud Power Sources & Arc Stud Guns
  - \* Racks
  - \* Running Gear/Trailers
  - \* Plasma Cutting Torches (except APT & SAF Models)
  - \* Field Options  
(NOTE: Field options are covered under True Blue® for the remaining warranty period of the product they are installed in, or for a minimum of one year — whichever is greater.)
4. 6 Months — Batteries
5. 90 Days — Parts
  - \* MIG Guns/TIG Torches

- \* Induction Heating Coils and Blankets
- \* APT & SAF Model Plasma Cutting Torches
- \* Remote Controls
- \* Accessory Kits
- \* Replacement Parts (No labor)
- \* Spoolmate Spoolguns
- \* Canvas Covers

Miller's True Blue® Limited Warranty shall not apply to:

1. **Consumable components; such as contact tips, cutting nozzles, contactors, brushes, slip rings, relays or parts that fail due to normal wear. (Exception: brushes, slip rings, and relays are covered on Bobcat, Trailblazer, and Legend models.)**
2. Items furnished by Miller, but manufactured by others, such as engines or trade accessories. These items are covered by the manufacturer's warranty, if any.
3. Equipment that has been modified by any party other than Miller, or equipment that has been improperly installed, improperly operated or misused based upon industry standards, or equipment which has not had reasonable and necessary maintenance, or equipment which has been used for operation outside of the specifications for the equipment.

MILLER PRODUCTS ARE INTENDED FOR PURCHASE AND USE BY COMMERCIAL/INDUSTRIAL USERS AND PERSONS TRAINED AND EXPERIENCED IN THE USE AND MAINTENANCE OF WELDING EQUIPMENT.

In the event of a warranty claim covered by this warranty, the exclusive remedies shall be, at Miller's option: (1) repair; or (2) replacement; or, where authorized in writing by Miller in appropriate cases, (3) the reasonable cost of repair or replacement at an authorized Miller service station; or (4) payment of or credit for the purchase price (less reasonable depreciation based upon actual use) upon return of the goods at customer's risk and expense. Miller's option of repair or replacement will be F.O.B., Factory at Appleton, Wisconsin, or F.O.B. at a Miller authorized service facility as determined by Miller. Therefore no compensation or reimbursement for transportation costs of any kind will be allowed.

TO THE EXTENT PERMITTED BY LAW, THE REMEDIES PROVIDED HEREIN ARE THE SOLE AND EXCLUSIVE REMEDIES. IN NO EVENT SHALL MILLER BE LIABLE FOR DIRECT, INDIRECT, SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES (INCLUDING LOSS OF PROFIT), WHETHER BASED ON CONTRACT, TORT OR ANY OTHER LEGAL THEORY.

ANY EXPRESS WARRANTY NOT PROVIDED HEREIN AND ANY IMPLIED WARRANTY, GUARANTY OR REPRESENTATION AS TO PERFORMANCE, AND ANY REMEDY FOR BREACH OF CONTRACT TORT OR ANY OTHER LEGAL THEORY WHICH, BUT FOR THIS PROVISION, MIGHT ARISE BY IMPLICATION, OPERATION OF LAW, CUSTOM OF TRADE OR COURSE OF DEALING, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR PARTICULAR PURPOSE, WITH RESPECT TO ANY AND ALL EQUIPMENT FURNISHED BY MILLER IS EXCLUDED AND DISCLAIMED BY MILLER.

Some states in the U.S.A. do not allow limitations of how long an implied warranty lasts, or the exclusion of incidental, indirect, special or consequential damages, so the above limitation or exclusion may not apply to you. This warranty provides specific legal rights, and other rights may be available, but may vary from state to state.

In Canada, legislation in some provinces provides for certain additional warranties or remedies other than as stated herein, and to the extent that they may not be waived, the limitations and exclusions set out above may not apply. This Limited Warranty provides specific legal rights, and other rights may be available, but may vary from province to province.





# Owner's Record

Please complete and retain with your personal records.

Model Name

Serial/Style Number

Purchase Date

(Date which equipment was delivered to original customer.)

Distributor

Address

City

State

Zip



## For Service

***Call 1-800-4-A-Miller or see our website at [www.MillerWelds.com](http://www.MillerWelds.com) to locate a DISTRIBUTOR or SERVICE AGENCY near you.***

Always provide Model Name and Serial/Style Number.

Contact your Distributor for:

Welding Supplies and Consumables

Options and Accessories

Personal Safety Equipment

Service and Repair

Replacement Parts

Training (Schools, Videos, Books)

Technical Manuals (Servicing Information and Parts)

Circuit Diagrams

Welding Process Handbooks

Contact the Delivering Carrier to:

File a claim for loss or damage during shipment.

For assistance in filing or settling claims, contact your distributor and/or equipment manufacturer's Transportation Department.

### Miller Electric Mfg. Co.

An Illinois Tool Works Company  
1635 West Spencer Street  
Appleton, WI 54914 USA

### International Headquarters—USA

USA Phone: 920-735-4505 Auto-Attended  
USA & Canada FAX: 920-735-4134  
International FAX: 920-735-4125

### European Headquarters – United Kingdom

Phone: 44 (0) 1204-593493  
FAX: 44 (0) 1204-598066

[www.MillerWelds.com](http://www.MillerWelds.com)

